



ACE

Engineering Academy
Leading Institute for ESE/GATE/PSUs

Hyderabad | Delhi | Ahmedabad | Bhopal | Pune | Bhubaneswar | Bengaluru
Lucknow | Patna | Chennai | Vijayawada | Vizag | Tirupathi | Kukatpally | Kolkata

ESE – 2019 **(MAINS)**

Questions with Detailed Solutions

MECHANICAL ENGINEERING

PAPER – II

ACE Engineering Academy has taken utmost care in preparing the **ESE-2019 MAINS** Examination solutions. Discrepancies, if any, may please be brought to our notice.

ACE Engineering Academy do not owe any responsibility for any damage or loss to any person on account of error or omission in these solutions. ACE Engineering Academy is always in the fore front of serving the students, irrespective of the examination type (GATE/ESE/PSUs/PSC/GENCO/TRANSCO etc.,).

All Queries related to **ESE - 2019 MAINS** Solutions are to be sent to the following email address
hyderabad@aceenggacademy.com | Contact Us : 040-23234418,19,20

MECHANICAL ENGINEERING

ESE _MAINS_2019_ (PAPER – II)

PAPER REVIEW

In this paper questions on Theory of Machines, Strength of materials, Engineering Mechanics, can be easily attempted.

Selection of Questions plays a vital role in securing a good score.

For example Section – B is relatively tougher than Section – A. So, choosing 3 questions from Section – A will fetch you a big advantage.

SUBJECT WISE REVIEW


	Subjects	Level	Marks
Section (A)	Mechanics	Easy	12
	Strength of Materials	Easy to moderate	62
	Theory of Machines	Easy	94
	Machine Design	Easy	72
Section (B)	Production	Easy to tough	66
	IM & OR	Easy	40
	Material Science	Easy to tough	52
	Mechatronics & Robotics	Easy to tough	72
	Maintenance Engineering	Easy	10

Subjects Experts,
ACE Engineering Academy

SECTION - A

01(a).


(i) A 10 m boom AB weighs 1 kN. The distance of centre of gravity is 5 m from A. For the position shown in the figure given below, determine the tension T in the cable and reaction at A:

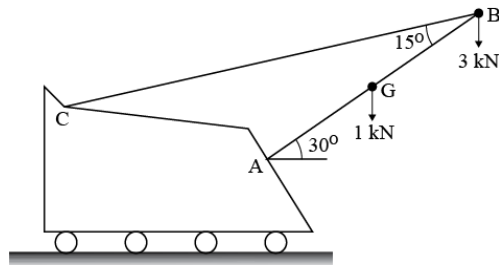

(6 M)

Sol:

F.B.D of boom is shown below :

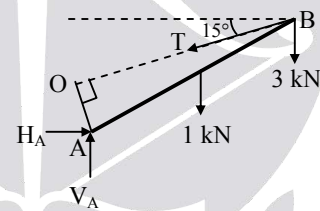

Taking moment about A,

$$T \times 2.59 = 1 \times 5 \cos 30^\circ + 3 \times 10 \cos 30^\circ$$

$$\Rightarrow T = 11.7 \text{ kN}$$


Final F.B.D

$$\Sigma F_x = 0$$

$$\Rightarrow H_A = 11.7 \cos 15^\circ = 11.3 \text{ kN}$$

$$\Sigma F_y = 0$$

$$\Rightarrow V_A = 3 + 1 + 11.7 \sin 15^\circ = 7.03 \text{ kN}$$

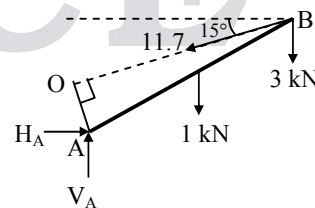


Net reaction,

$$= \sqrt{7.03^2 + 11.3^2}$$

$$= 13.31 \text{ kN}$$

- (ii) A rope making $1\frac{1}{4}$ turns around a stationary horizontal drum is used to support a weight as shown in the figure given below. If the coefficient of friction is 0.3, what range of weight can be supported by exerting an 800 N force at the end of the rope?

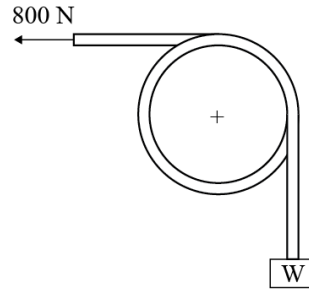

(6 M)

Sol: Angle of contact = $1\frac{1}{4}$ turns

$$= 2\pi + \pi/2 = \frac{5\pi}{2}$$

Case (i): To hold W

$$\frac{T_{\max}}{T_{\min}} = e^{\mu\theta}$$

$$\frac{W}{800} = e^{\mu\theta}$$

$$W = e^{\left(\frac{5\pi}{2} \times 0.3\right)} \times 800$$

$$W = e^{2.35} \times 800$$

$$W = 8388.45 \text{ N}$$



Case (ii): To just lift the W

$$\frac{800}{W} = e^{\mu\theta}$$

$$W = \frac{800}{e^{\left(\frac{5\pi}{2} \times 0.3\right)}}$$

$$W = e^{-2.35} \times 800$$

$$W = \frac{800}{10.48} = 76.33 \text{ N}$$

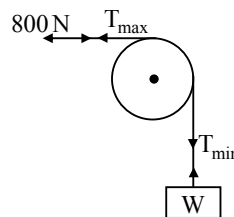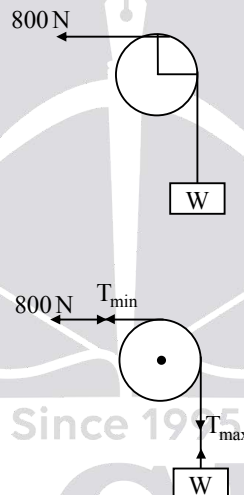

01(b). A steel tube of 100 mm internal diameter and 10 mm wall thickness in a plant is lined internally with well-fitted copper sleeve of 2 mm wall thickness. If the composite tube is initially unstressed, calculate the hoop stress set up assumed to be uniform throughout the wall thickness, in a unit length of each part of the tube due to an increase in temperature of 100 °C.

For steel, $E = 208 \text{ GPa}, \alpha = 11 \times 10^{-6} / ^\circ\text{C}$

For copper, $E = 104 \text{ GPa}, \alpha = 18 \times 10^{-6} / ^\circ\text{C}.$ **(12 M)**

Sol:

For steel tube :


$$d_i = 100 \text{ mm}, t_1 = 10 \text{ mm},$$

and $E = 208 \text{ GPa}, \alpha = 11 \times 10^{-6} / ^\circ\text{C}$

For Copper sleeve :

$$d_o = 100 \text{ mm}, t_2 = 2 \text{ mm},$$

and $E = 104 \text{ GPa}, \alpha = 18 \times 10^{-6} / ^\circ\text{C}$

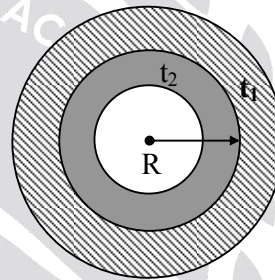

When temperature rises by 100°C, copper will try to expand faster than steel. Consequently, steel experiences tensile hoop stress whereas copper experiences compressive hoop stress.

Equilibrium gives \rightarrow (For unit length)

$$\sigma_{st} \times 10 \times 1 = \sigma_{cu} \times 2 \times 1$$

$$\Rightarrow \sigma_{cu} = 5\sigma_{st} \quad \text{-----(i)}$$

Compatibility condition \rightarrow (At interface)

$$\alpha_{cu} (\pi d_{cu}) \Delta T - \frac{\sigma_{cu} (\pi d_{cu})}{E_{cu}} = \alpha_{st} (\pi d_{st}) \Delta T + \frac{\sigma_{st} (\pi d_{st})}{E_{st}}$$

$$\alpha_{cu} \Delta T - \frac{\sigma_{cu}}{E_{cu}} = \alpha_{st} \Delta T + \frac{\sigma_{st}}{E_{st}}$$

$$18 \times 10^{-6} \times 100 - \frac{5\sigma_{st}}{104 \times 10^3} = 11 \times 10^{-6} \times 100 + \frac{\sigma_{st}}{208 \times 10^3}$$

$$\frac{11\sigma_{st}}{208 \times 10^3} = 7 \times 10^{-4}$$

$$\Rightarrow \sigma_{st} = \frac{208 \times 10^{-1} \times 7}{11} = 13.24 \text{ MPa}$$

01(c). (i) What is kinematic pair? How are kinematic pairs classified? Explain.

(6 M)

Sol: Kinematic Pair:

Interconnection between two links that allows the relative motion between them is known as kinematic pair.

Classification of Kinematic pairs:

(a) Based on Degrees of Freedom:

- A kinematic pair allows few degrees of freedom and constraints some of them.
- A pair that constrains all the degrees of freedom of the second link relative to the first link is not considered as a kinematic pair, it is a rigid joint.
- On the basis of degrees of freedom there are following 6 pairs.

Pair	Symbol	Pair Variable	Degrees of Freedom	Relative motion
Revolute	R	$\Delta\theta$	1	Circular
Prismatic	P	Δs	1	Rectilinear
Helical	H	$\Delta\theta$ or Δs	1	Helical
Cylinder	C	$\Delta\theta$ and Δs	2	Cylindric
Sphere	S	$\Delta\theta, \Delta\phi, \Delta\psi$	3	Spheric
Flat	F	$\Delta x, \Delta y, \Delta\theta$	3	Planar

(b) Based on Nature of contact:

Based on the nature of contact between the two links the kinematic pairs are classified as *lower pairs and higher pairs*.

Lower pairs:

- When the two bodies have surface or area contact between them they are referred as lower pairs.
- The relative motion in a lower pair is either purely turning or sliding.

Ex: Nut turning on screw, universal joint etc.

Higher pairs:

- When the contact between the bodies is a point or line contact they are referred as higher pairs.
- The relative motion in a higher pair is a combination of sliding and turning.

Ex: Cam and Follower pair, ball and roller bearings and gears etc.

(c) Kinematic pair according to Mechanical construction.


(i) Closed pair

(ii) Open pair

01(c).ii) A four - bar mechanism has the following dimensions:

$$DA = 200 \text{ mm}, CB = AB = 300 \text{ mm}, DC = 500 \text{ mm}$$

The link DC is fixed and the angle ADC is 60°. The driving link DA rotates uniformly at a speed of 100 r.p.m. clockwise and constant driving torque has the magnitude of 50 N-m. Determine the velocity of point B and angular velocity of the driven link CB. If the efficiency is 70%, calculate also the resisting torque:

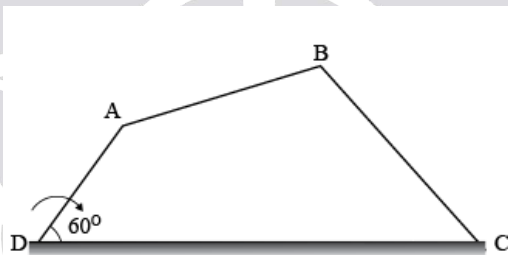

(6 M)

Sol: Given data,

$$DA = 500 \text{ mm}$$


$$CB = AB = 300 \text{ mm}$$

$$DC = 500 \text{ mm}$$

$$\angle ADC = 60^\circ$$

$$\text{Let } 1 \text{ cm} = 100 \text{ mm}$$

$$\omega_2 = \omega_{DA} = 100 \text{ rpm CW}$$

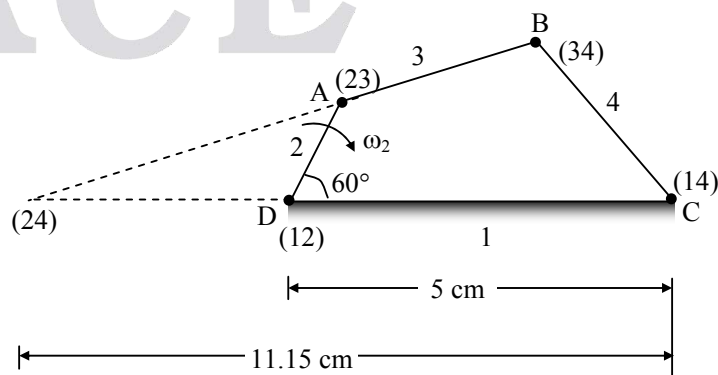

$$\therefore V_{24} = I_{12}I_{24} \cdot \omega_2 = I_{14}I_{24} \cdot \omega_4$$

$$\Rightarrow \omega_4 = \frac{I_{12}I_{24} \times 100}{I_{14}I_{24}} = \frac{11.15 \times 100}{6 \times 100} \times 100 = 185.83 \text{ rpm}$$

$$V_B = CB \cdot \omega_4 = 300 \times \frac{2\pi \times 185.83}{60} = 5838.12 \text{ mm/s}$$


$$\therefore \eta = 0.7 = \frac{\text{Power at output}}{\text{Power at input}}$$

$$0.7 = \frac{\tau_4 \cdot \omega_4}{\tau_2 \cdot \omega_2}$$

$$\tau_4 = \frac{0.7 \times 50 \times 100}{185.83} = 18.834 \text{ N-m}$$

01(d).

- (i). The tension T in the spring as shown in the figure given below can be assumed to be constant for small displacements. Determine the natural frequency of the vertical vibrations of the spring and also show that the period of vibration is greatest when $a = b$;

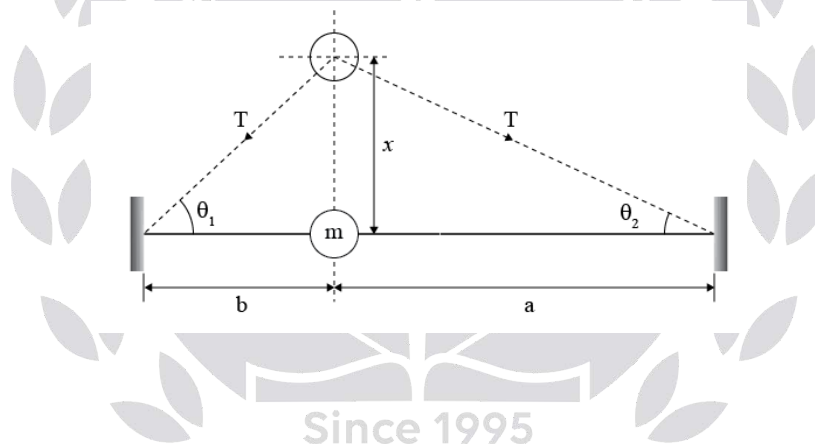

(6 M)

Sol: $T \sin \theta_1 + T \sin \theta_2 = m\ddot{x}$

Newton's method

$$T \left(\frac{x}{b} \right) + T \left(\frac{x}{a} \right) = m\ddot{x}$$

$$\omega_n = \sqrt{T \left(\frac{1}{b} + \frac{1}{a} \right)}$$

$$\omega_n = \sqrt{T \left(\frac{a+b}{ab} \right)}$$

$$\omega_n = \sqrt{\frac{T \cdot l}{a(l-a)}}$$

$$a + b = l$$

'T' will be maximum if ω_n is minimum.

$$\frac{d\omega_n}{da} = 0$$

$$\frac{d}{da} [a\ell - a^2] = 0 \Rightarrow \ell - 2a = 0$$

$$\Rightarrow a = \frac{\ell}{2} \quad \text{i.e. } a = b = \frac{\ell}{2}$$

$$\omega_n = \sqrt{\frac{4T}{m\ell}}$$

01(d).(ii) A vibrating system has the following constants :

$$W = 19.62 \text{ kg}, K = 8 \text{ kg/cm}, C = 0.08 \text{ kg-s/cm}$$

Determine:

- (1) damping factor;**
- (2) natural frequency of damped oscillations;**
- (3) logarithmic decrement.**

Here, W = weight of mass, K = Spring stiffness, C = Damping coefficient.

(6 M)

Sol: $m = 19.62 \text{ kg},$

$$k = 8 \text{ kg/cm} = 8 \times 9.81 \times 10^2 \text{ N/m} = 7848 \text{ N/m},$$

$$c = 0.08 \text{ kg-sec/cm} = 0.08 \times 9.81 \times 100 = 78.48 \text{ N-sec/m}$$

Natural un-damped frequency,

$$\omega_n = \sqrt{\frac{k}{m}} = \sqrt{\frac{7848}{19.62}} = 20 \text{ rad/sec}$$

$$(i) \text{ Damping factor, } \xi = \frac{c}{2m\omega_n} = \frac{78.48}{2 \times 19.62 \times 20} = 0.1$$

$$(ii) \text{ Natural frequency of damped oscillations, } \omega_d = \omega_n \sqrt{1 - \xi^2}$$

$$= 20 \times \sqrt{1 - (0.1)^2}$$

$$= 19.899 \text{ rad/sec}$$

$$(iii) \text{ Logarithmic decrement, } \delta = \frac{2\pi\xi}{\sqrt{1 - \xi^2}} = \frac{2\pi \times 0.1}{\sqrt{1 - (0.1)^2}} = 0.6314$$

ESE / GATE / PSUs 2020 - 2021 ADMISSIONS OPEN

GATE + PSUs - 2020

Regular Batches @ Dilsukhnagar	08 th & 22 nd July, 05 th & 20 th August 2019
Regular Batch @ Kukatpally	01 st July 2019
Regular Batches @ Pune	01 st & 15 th July 2019
Weekend & Regular Batches @ Chennai	06 th July 2019
Regular Batch @ Bengaluru	08 th July 2019

ESE + GATE + PSUs - 2020

Regular Batch @ Dilsukhnagar	08 th July 2019
Regular Batch @ Pune	01 st July 2019

GATE + PSUs - 2021

Morning Batches @ Abids	12 th July & 10 th August 2019
Morning & Evening Batches @ Dilsukhnagar	12 th July & 10 th August 2019
Morning & Evening Batches @ Kukatpally	12 th July & 10 th August 2019
Weekend Batches @ Pune	6 th July & 17 th August 2019
Weekend Batch @ Chennai	6 th July 2019
Weekend Batch @ Bengaluru	3 rd August 2019
Weekend Batch @ Vijayawada	7 th July 2019
Weekend Batch @ Tirupati	13 th July 2019
Weekend Batch @ Vizag	20 th July 2019

ESE + GATE + PSUs - 2021

Morning Batches @ Abids	12 th July & 10 th August 2019
Weekend Batches @ Pune	6 th July & 17 th August 2019

IES GENERAL STUDIES BATCH

Regular Batch @ Abids	12 th July 2019
Weekend Batch @ Pune	13 th July 2019

GENCO / TRANSO / DISCOMS BATCH

Regular Batch @ Abids	14 th July 2019
------------------------------	----------------------------

for more batch details please visit: www.aceenggacademy.com

01(e). Differentiate between 'shaft' and 'axle'. A solid shaft of diameter d is used in power transmission. Due to the modification of existing transmission system, the solid shaft is required to be replaced by a hollow shaft of the same material and equally strong in torsion. The weight of the hollow shaft per unit length is to be half of the solid shaft. Determine the outer diameter of the hollow shaft in terms of d . (12 M)

Sol: Shaft: A shaft is a rotating or stationary member, usually of circular cross-section, that supports transmission elements like gears, pulleys and sprockets and transmits power.

Shafts may be subjected to bending, axial, torsional loads acting single or in combination with one another.

Axle: An axle is a shaft, either stationary or rotating, not subjected to a torsion load.

Ex: Rear axle of railway wagon.

Outer diameter of hollow shaft in terms of solid shaft diameter, d

As both the shafts are equally strong in torsion,

$$T = \frac{\pi}{16} \tau d^3 = \frac{\pi}{16} \tau \left[\frac{d_o^4 - d_i^4}{d_o} \right]$$

d_o = outer diameter, d_i = inner diameter

$$\therefore d_i^4 = d_o^4 - d^3 d_o \quad \dots\dots\dots(1)$$

As the hollow shaft weighs half of solid shaft for same material and length,

$$\frac{\pi}{4} (d_o^2 - d_i^2) = \frac{1}{2} \frac{\pi}{4} d^2$$

$$d_i^2 = d_o^2 - \frac{d^2}{2} \quad \dots\dots\dots(2)$$

Eliminating d_i from equation 1 and 2

$$d^2 d_o^2 - d^3 d_o - \frac{d^4}{4} = 0 \dots\dots\dots(3)$$

$$\therefore d_o = \frac{d + \sqrt{2}d}{2}$$

(Considering the positive root of equation 3)

02(a). The turbine rotor of a ship has a mass of 3000 kg. It has a radius of gyration of 0.45 m and a speed of 2000 r.p.m clockwise when looking from stern. Determine the gyroscopic couple and its effect on the ship

- (i) When the ship is steering to the left on a curve of 100 m radius at a speed of 30 km/hr;
 (ii) When the ship is pitching in a simple harmonic motion, the bow falling with its maximum velocity. The period of pitching is 40 seconds and the total angular displacement between the two extreme positions of pitching is 12 degrees. (20 M)

Sol: $m = 3000 \text{ kg}$, $k = 0.45 \text{ m}$


$N = 2000 \text{ rpm CW}$ when looked from stern.

(i) Ship is steering to left

$V = 30 \text{ km/hr}$

$R = 100 \text{ m}$

$$\begin{aligned} \text{Gyroscopic couple, } C &= I\omega_s \omega_p = mk^2 \times \frac{2\pi N}{60} \times \frac{V}{R} \\ &= 3000(0.45)^2 \times \frac{2\pi \times 2000}{60} \times \frac{30 \times 1000}{100 \times 3600} \\ &= 10602.87 \text{ N-m} \end{aligned}$$

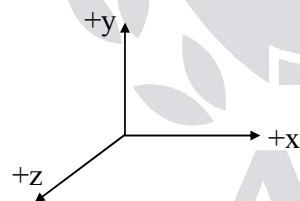

Since 1995

ACE
 Axis

Spin

+x	\hat{i}
+y	\hat{j}
+z	\hat{k}

Process

Reactive Gyroscopic couple

Bow will raise and stern moves down.

(ii) Ship is pitching in simple harmonic motion (Bow is falling)

Let the displacement equation be, $\theta = \theta_0 \sin \omega t$

Velocity, $\dot{\theta} = \theta_0 \omega \cos \omega t$

$$T = 40 \text{ s}$$

$$\theta_o = \frac{12^\circ}{2} = 6^\circ$$

$$\begin{aligned} \text{Gyroscopic couple, } C &= I\omega \cdot \omega_p = mk^2 \times \frac{2\pi N}{60} \times \theta_o \omega \\ &= mk^2 \times \frac{2\pi N}{60} \times \left(6^\circ \times \frac{\pi}{180^\circ}\right) \times \frac{2\pi}{T} \end{aligned}$$

$$T = 3000(0.45)^2 \times \frac{2\pi \times 2000}{60} \times \frac{\pi}{30^\circ} \times \frac{2\pi}{40} = 2092.92 \text{ N-m}$$

	Axis	
Spin	+x	$+\hat{i}$
Precession	-z	$-\hat{k}$
Reactive Gyroscopic couple	+y	$+\hat{j}$

\therefore Ship will turn towards portside or left turn.

02(b). A steel cantilever of length 2 m of circular cross-section, 50 mm in diameter, carries uniformly distributed load of intensity w . What is the maximum value of w so that deflection at free end is not exceed 1 mm? Find out the slope at free end. Take $E = 200 \text{ GPa}$.

(20 M)

Sol: Given data:

$$\ell = 2 \text{ m}; \quad d = 50 \text{ mm} = 0.050 \text{ m}; \quad E = 200 \times 10^9 \text{ N/m}^2$$

 
$$y_{\max} = 1 \text{ mm} = 1 \times 10^{-3} \text{ m}$$

$$y_B = \frac{w\ell^4}{8EI} = 1 \times 10^{-3} \text{ m}$$

$$= \frac{w \times 2^4}{8 \times 200 \times 10^9 \times \frac{\pi}{64} \times 0.05^4} = 1 \times 10^{-3}$$

$$w = 30.67 \text{ N/m}$$

$$\theta_B = \frac{w\ell^3}{6EI} = \frac{30.67 \times 2^3}{6 \times 200 \times 10^9 \times \frac{\pi}{64} \times 0.05^4} = 0.667 \times 10^{-3} \text{ radians}$$



02(c). A thick cylinder is subjected to both internal and external pressure. The internal diameter of the cylinder is 200 mm and the external diameter is 250 mm. If the maximum permissible stress is 30 N/mm² and the external pressure is 8 N/mm², determine the intensity of internal radial pressure. (20 M)

Sol: Given data:

$$d_i = 200 \text{ mm} \Rightarrow r_i = 100 \text{ mm}$$

$$d_o = 250 \text{ mm} \Rightarrow r_o = 125 \text{ mm}$$

$$\sigma_{\max} = 30 \text{ N/mm}^2, \quad p_{x=125 \text{ mm}} = 8 \text{ N/mm}^2$$

Lami's equations:

$$p_x = \frac{b}{x^2} - a \quad \dots\dots\dots (1)$$

$$\sigma_x = \frac{b}{x^2} + a \quad \dots\dots\dots (2)$$

At $x = 125 \text{ mm}$ $p_x = 8 \text{ N/mm}^2$

$$\therefore 8 = \frac{b}{125^2} - a \quad \dots\dots\dots (3)$$

At $x = 100 \text{ mm}$; $\sigma_x = 30 \text{ N/mm}^2$

$$\therefore 30 = \frac{b}{100^2} + a \quad \dots\dots\dots (4)$$

Solving the above two equations, we get

$$a = 29.415; \quad b = 5.85 \times 10^5$$

$$\therefore p_x = \frac{5.85 \times 10^5}{x^2} - 29.415 \quad \text{(from (1))}$$

$$\sigma_x = \frac{5.85 \times 10^5}{x^2} + 29.415 \quad \text{(from (2))}$$

At $x = 100 \text{ mm}$,

$$p_{100} = \frac{5.85 \times 10^5}{100^2} - 29.415 = 29.085 \text{ N/mm}^2$$

Result: $p_{x=100 \text{ mm}} = 29.085 \text{ N/mm}^2$

REGULAR BATCHES

REGULAR BATCHES

GATE+PSUs - 2020

ABIDS DSNR **KOTHAPET KKP**

24th June | 01st July | 08th July | 22nd July |
05th August | 20th August 2019

Start Early... Gain Surely...

MPSC MAINS

CIVIL ENGINEERING

REGULAR BATCH: 15th July 2019

FREE ORIENTATION SESSION & DEMO CLASS

06th July 2019, 10am TO 1pm @ PUNE

03(a). A horizontal gas engine running at 200 r.p.m. has a bore of 200 mm and a stroke of 400 mm. The connecting rod is 900 mm long and the reciprocating parts weigh 20 kg. When the crank has turned through an angle of 30° from the inner dead centre, the gas pressures on the cover and the crank sides are 500 kN/m^2 and 60 kN/m^2 respectively. The diameter of the piston rod is 40 mm. Determine

(i) turning moment on the crankshaft;

(ii) thrust on the bearings;

(iii) acceleration of the flywheel which has a mass of 8 kg and radius of gyration of 600 mm while the power of the engine is 22 kW. (20 M)

Sol: Speed $N = 200 \text{ rpm}$

$$D = 200 \text{ mm} = 0.2 \text{ m}$$

Stroke length = 400 mm

$$\Rightarrow \text{Crank radius} = 200 \text{ mm} = 0.2 \text{ m}$$

$$\ell = 900 \text{ mm}$$


$$m_{\text{rec}} = 20 \text{ kg}$$

$$\theta = 30^\circ$$

$$P_{\text{cover}} = 500 \text{ kN/m}^2$$

$$P_{\text{crank}} = 60 \text{ kN/m}^2$$

$$D_{\text{piston rod}} = 40 \text{ mm}$$

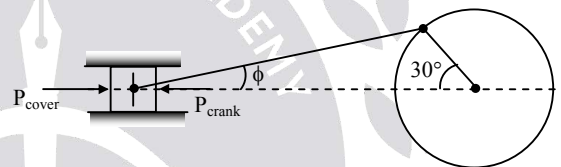

$$\text{Gas force, } F_{\text{gas}} = (P_{\text{cover}} \cdot A_{\text{cover}}) - (P_{\text{crank side}} \cdot A_{\text{crank side}})$$

$$= 500 \times \frac{\pi}{4} (0.2)^2 - 60 \times \frac{\pi}{4} (0.2^2 - 0.04^2)$$

$$= \left[500 \times (0.2)^2 - 60(0.2^2 - 0.04^2) \right] \frac{\pi}{4}$$

$$= (20 - 2.304) \times \frac{\pi}{4}$$

$$= 13.898 \text{ kN}$$

$$\text{Inertia force } F_i = m r \omega^2 \left[\cos \theta + \frac{\cos 2\theta}{n} \right]$$

$$n = \frac{\ell}{r} = \frac{900}{200} = 4.5$$

$$F_i = 20 \times 0.2 \times \left(\frac{2\pi \times 200}{60} \right)^2 \left[\cos 30^\circ + \frac{\cos 60^\circ}{4.5} \right]$$

$$F_i = 1714.48 \text{ N}$$

Piston effort

$$F_p = F_{\text{gas}} - F_i = 13.898 \times 10^3 - 1714.48 = 12183.52 \text{ N}$$

$$\therefore \sin \beta = \frac{\sin \theta}{n} \Rightarrow \beta = 6.379^\circ$$

(i) Turning moment on crankshaft

$$\begin{aligned} T &= \frac{F_p}{\cos \beta} \times r \times \sin(\theta + \beta) \\ &= \frac{12183.52}{\cos 6.379^\circ} \times 0.2 \times \sin(30^\circ + 6.379^\circ) = 1454.27 \text{ N-m} \end{aligned}$$

(ii) Thrust force on bearing = $F_p \cdot \cos(\theta + \beta)$
 $= 12183.52 \cos(30^\circ + 6.379^\circ) = 9809.09 \text{ N}$

(ii) Mass of flywheel = 8 kg,

$$k = 600 \text{ mm,}$$

Power = 22 kW

$$\therefore P = \frac{2\pi N T_m}{60}$$

$$T_m = \frac{60 \times 22 \times 10^3}{2\pi \times 200} = 1050.42 \text{ N-m}$$

$$T_{\text{supply}} = 1454.27 \text{ N-m}$$

$$T_{\text{fly}} = T_{\text{supply}} - T_{\text{load}}$$

and $T_{\text{load}} = T_{\text{mean}}$


$$T_{\text{fly}} = 1454.27 - 1050.42$$

$$I_{\text{fly}} \cdot \alpha_{\text{fly}} = 403.8473 \text{ N-m}$$

$$mk^2 \cdot \alpha_{\text{fly}} = 403.8473$$

$$\alpha_{\text{fly}} = \frac{403.8473}{8 \times 0.6^2} = 140.224 \text{ rad/s}^2$$

03(b). An epicyclic gear consists of three gears A, B and C as shown in the figure given below. The gear A has 72 internal teeth and gear C has 32 external teeth. The gear B meshes with both A and C and is carried on an arm EF which rotates about the centre of A at 20 r.p.m. If the gear A is fixed, determine the speed of gears B and C:

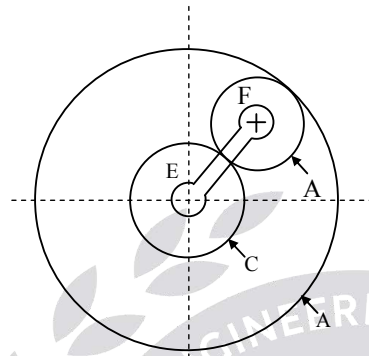
(20 M)
Sol:

Condition	Arm	32 Gear C	20 Gear B	72 Gear A
Arm EF is fixed, Gear C is rotating with +x rpm cw.	0	+x	$-x \cdot \frac{32}{20}$	$-x \cdot \frac{32}{20} \times \frac{20}{72}$
Arm is rotating with +y rpm cw	+y	y+x	$y - x \times \frac{8}{5}$	$y - x \times \frac{4}{9}$

$$R_A = R_C + 2R_B \quad (\because m_A = m_C = m_B)$$

$$T_A = T_C + 2T_B$$

$$72 = 32 + 2T_B$$

$$T_B = 20$$

Gear A is fixed,

$$\omega_A = 0$$

$$y - \frac{4x}{9} = 0$$

$$y = \frac{4x}{9} \Rightarrow x = \frac{9y}{4} = \frac{9 \times 20}{4} = 45 \text{ rpm}$$

$$\omega_B = y - \frac{8x}{5} = 20 - \frac{8 \times 45}{5} = -52 \text{ rpm CW} = 52 \text{ rpm CCW}$$

$$\omega_C = y + x = 20 + 45 = 65 \text{ rpm}$$

03(c). A single-cylinder reciprocating engine has a speed of 300 r.p.m., stroke 300 mm, mass of reciprocating parts 50 kg, mass of revolving parts at 150 mm radius 37 kg. If two - thirds of the reciprocating parts and all the revolving parts are to be balanced, find:

(i) the balance mass required at a radius of 300 mm;

(ii) the residual unbalanced force when the crank has rotated 60° from top dead centre.

(10 M)

Sol: Speed, $\omega = \frac{2\pi \times 300}{60} = 10\pi \text{ rad/s}$

Stroke length, $2r = 300 \text{ mm}$
 $r = 0.15 \text{ m}$

$m_{\text{recip}} = 50 \text{ kg}$

$m_{\text{rotating}} = 37 \text{ kg}$

$\therefore B.b = c m_{\text{recip}}.r + m_{\text{rot}}.r_{\text{rot}}$

$B \times \frac{300}{1000} = \left(\frac{2}{3} \times 50 \times 0.15 \right) + (37 \times 0.15)$

$0.3B = 5 + 5.55$

Mass to the balance, $B = 35.16 \text{ kg}$

Unbalanced force along the line of stroke

$F_x = (1 - c) m r \omega^2 \cos \theta$

$F_x = \left(1 - \frac{2}{3} \right) \times 50 \times 0.15 \times \left(\frac{2\pi \times 300}{60} \right)^2 \times \cos 60^\circ = 1233.7 \text{ N}$

Unbalanced force perpendicular to line of stroke,


$F_y = c m r \omega^2 \sin \theta$

$= \left(\frac{2}{3} \right) \times 50 \times 0.15 \times \left(\frac{2\pi \times 300}{60} \right)^2 \times \sin 60^\circ = 4273.67 \text{ N}$

Resultant unbalanced force, $R = \sqrt{(F_x)^2 + (F_y)^2}$

$= \sqrt{(1233.7)^2 + (4273.67)^2} = 4448.17 \text{ N}$

03(d). Draw the shear force and bending moment diagram for the cantilever beam as shown in the figure given below:

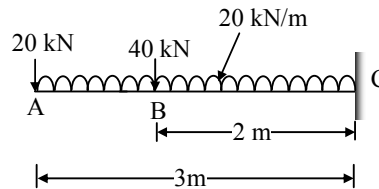

(10 M)

Sol: $(+)\uparrow \Sigma F_y = 0$


$$R_C - 20 - 40 - 20 \times 3 = 0$$

$$R_C = 20 + 40 + 60 = 120 \text{ kN}$$

$(+)\circlearrowleft \Sigma M_C = 0$

$$-20 \times 3 - 40 \times 2 - (20 \times 3)(1.5) + M_C = 0$$

$$M_C = 60 + 80 + 90 = 230 \text{ kN-m}$$

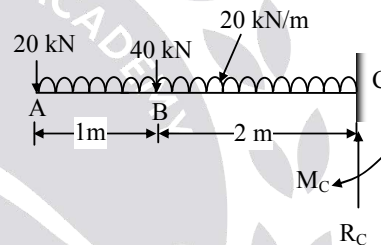


Shear force calculation

$$F_A = -20 \text{ kN}$$

$$F_{B,\text{left}} = -20 - (20 \times 1) = -40 \text{ kN}$$

$$F_{B,\text{right}} = -40 - 40 = -80 \text{ kN}$$

$$F_C = R_C = -120 \text{ kN}$$

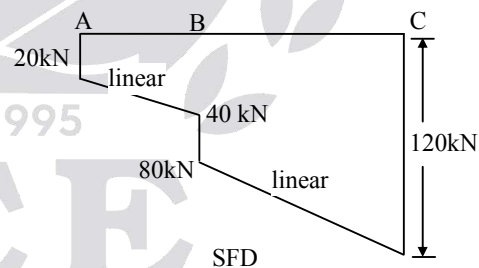


Bending moment calculation

$$M_A = 0$$

$$\begin{aligned} M_B &= -20 \times 1 - (20 \times 1)(0.5) \\ &= -20 - 10 = -30 \text{ kN-m} \end{aligned}$$

$$\begin{aligned} M_C &= (-20 \times 3) - (40 \times 2) - (20 \times 3)(1.5) \\ &= -230 \text{ kN-m} \end{aligned}$$

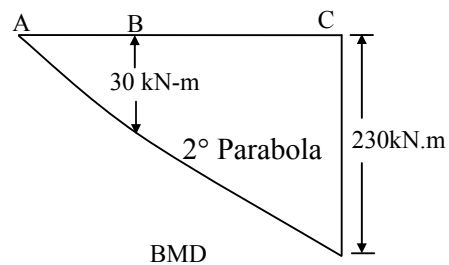

GATE - 2020

Online Test Series

Starts from 2nd May 2019

No. of Tests : 64

+

Free 52 Practice Tests of
GATE - 2019 Online Test Series

Total Tests : 116

ESE - 2020 PRELIMS

Online Test Series

Starts from 15th May 2019

No. of Tests : 44

+

Free 30 Practice Tests of
ESE - 2019 Online Test Series

Total Tests : 74

GATE+ESE - 2020

Online Test Series
Combination Pack

All tests will be available till
GATE - 2020 & ESE -2020 (Prelims)
examinations respectively.

- Detailed solutions are available.
- Video solutions are also available for difficult questions.

- All India rank will be given for each test.
- Comparison with all India toppers of ACE students.

☎ 040 - 48539866 / 040 - 40136222

✉ testseries@aceenggacademy.com

KPTCL - AE & AEE

Online Test Series

Karnataka Power Transmission Corporation Limited

No. of Tests : 16

Subject Wise Tests : 13 | Mock Tests - 3

Electrical Engineering

Starts From **8th June 2019**

All tests will be available till KPTCL Examination

☎ 040 - 48539866 / 040 - 40136222


✉ testseries@aceenggacademy.com

04(a).

- (i) Describe angular contact bearings and taper roller bearings with the help of neat sketches. Also, cite at least two advantages and two disadvantages of each. (8 M)**

Sol: Angular Contact Bearing:

In angular contact bearing, the grooves in inner and outer races are so shaped that the line of reaction at the contact between balls and races makes an angle with the axis of the bearing. This reaction has two components angular contact bearing can take radial and thrust loads.

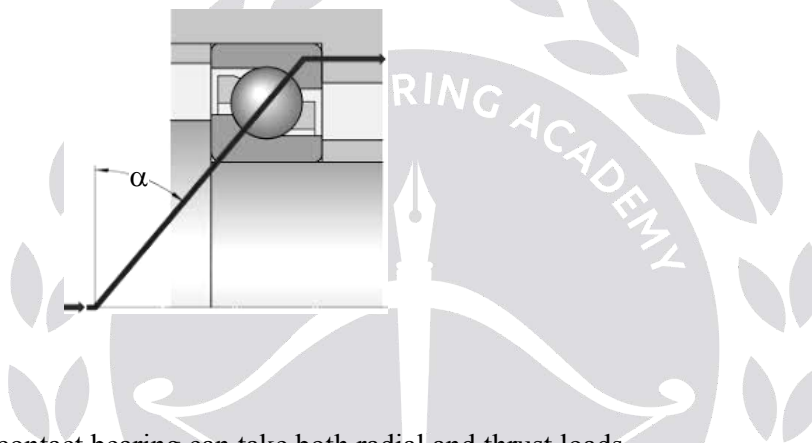


Advantages:

- Angular contact bearing can take both radial and thrust loads.
- In angular contact bearing, one side of the groove in the outer race is cut away to permit the insertion of larger number of balls than that of deep groove ball bearing. This permits the bearing to carry relatively large axial and radial loads. Therefore, the load carrying capacity of angular contact bearing is more than that of deep groove ball bearing.

Disadvantages:

- Two bearings are required to take thrust load in both directions.
- The angular contact bearing must be mounted without axial play.
- The angular contact bearing requires initial pre-loading.

Taper Roller Bearing: The taper roller bearing consists of rolling elements in the form of a frustum of cone. They are arranged in such a way that the axes of individual rolling elements intersect in a common apex point on the axis of the bearing. In kinematics analysis, this is the essential requirement for pure rolling motion between conical surfaces. In taper roller bearing, the line of resultant reaction through the rolling elements make an angle with the axis of the bearing. Therefore, taper roller bearing can carry both radial and axial loads.

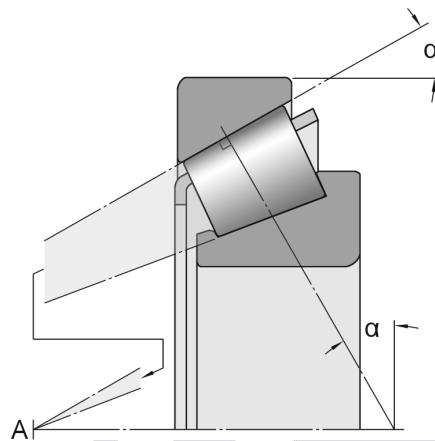

Advantages:

- Taper roller bearing can take heavy radial and thrust loads.
- Taper roller bearing has more rigidity
- Taper roller bearing can be easily assembled and disassembled due to separate parts.

Disadvantages:

- It is necessary to use two taper roller bearings on the shaft to balance the axial force.
- It is necessary to adjust the axial position of the bearing with pre-load. This is essential to coincide the apex of the cone with the common apex of the rolling elements.
- Taper roller bearing cannot tolerate misalignment between the axes of the shaft and the housing bore.
- Taper roller bearings are costly.

04(a).

- (ii) A pair of spur gears with 20° full-depth involute teeth consists of a 20 teeth pinion meshing with a 41 teeth gear. The module is 3 mm while the face width is 40 mm. The material for both the pinion and the gear is steel having an ultimate tensile strength of 660 N/mm^2 . The gears are heat-treated to a surface hardness of 400 BHN. The pinion rotates at 1500 r.p.m. and the service factor is 2.0. Assume that the velocity factor accounts for the dynamic load and the factor of safety is 1.5. Determine the rated power that the gears can transmit. Assume a Lewis form factor of 0.32. (12 M)**

Sol:

$$\phi = 20^\circ, \quad T_p = 20, \quad T_G = 41, \quad m = 3 \text{ mm},$$

$$w = 40 \text{ mm}, \quad S_{ut} = 660 \text{ N/mm}^2, \quad \text{BHN} = 400$$

$$N_p = 1500 \text{ rpm}, \quad c_s = 2.0, \quad F_s = 1.5, \quad \text{Power} = ?, \quad y = 0.32$$

Since, gear and pinion are made of same material, the design is based on pinion.

Dynamic load carrying capacity of pinion based on Lewis equation is

$$F_t = \frac{S_{ut} w m y c_v}{c_s} \quad [\text{where } c_v \text{ is velocity factor}]$$

$$= \frac{660}{1.5} \times \frac{40 \times 3 \times 0.32}{2.0} \times c_v$$

$$V = \frac{\pi d_p N_p}{60} = \frac{\pi \times m T_p \times N_p}{1000 \times 60}$$

$$= \frac{\pi \times 3 \times 20 \times 1500}{1000 \times 60} = 4.712 \text{ m/s}$$

\therefore Since, $V < 10 \text{ m/s}$

$$\text{Assuming, } c_v = \frac{3}{3+V} = \frac{3}{3+4.712} = 0.389$$

$$F_t = \frac{660}{1.5} \times \frac{40 \times 3 \times 0.32 \times 0.389}{2} = 3.286 \text{ kN}$$

Load carrying capacity based on wear strength,

$$F_w = k d_p W Q$$

$$k = \frac{S_{ew}^2 \sin \phi}{1.4} \left(\frac{1}{E_p} + \frac{1}{E_G} \right)$$

$$S_{ew} = 2.76 \text{ BHN} - 70 \text{ MPa}$$

$$= 2.76 \times 400 - 70$$

$$= 1034 \text{ MPa}$$

\therefore Dynamic load factor,

$$k = \frac{1034^2 \times \sin 20}{1.4} \left(\frac{1}{2 \times 10^5} + \frac{1}{2 \times 10^5} \right) = 2.6$$

$$E = 2 \times 10^5 \text{ N/mm}^2 \text{ for steel (Assumed)}$$

Ratio factor,

$$Q = \frac{2T_G}{T_G + T_P} = \frac{2 \times 41}{41 + 20} = 1.34$$

$$\begin{aligned} \therefore F_w &= 2.6 \times mT_P \times w \times Q \\ &= 2.6 \times 3 \times 20 \times 40 \times 1.34 = 8.361 \text{ kN} \end{aligned}$$

Since $F_t < F_w$, design is based on F_t


Hence, the power transmitted is,

$$P = F_t \times V = 3.286 \times 4.712 = 15.48 \text{ kW}$$

04(b). What advantages do the welded joints offer in comparison to riveted joints? Neatly sketch the basic symbols used to specify the following types of weld:

- (i) Fillet
- (ii) Square butt
- (iii) Single V-butt
- (iv) Spot
- (v) Seam
- (vi) Projection

A beam of rectangular cross-section is welded to a support by means of fillet welds as shown in the figure given below. Determine the size of the welds if the permissible shear stress is 80 N/mm^2 . (20 M)

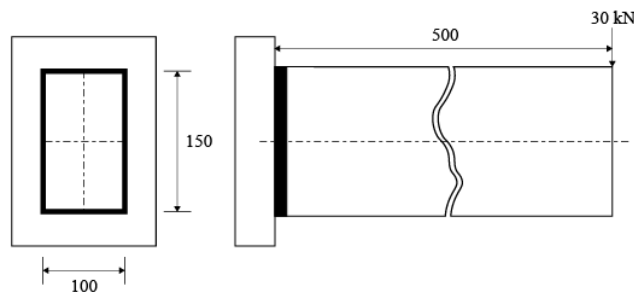

Sol: Welded joints offer the following advantages compared with Riveted Joints:

- (i) Riveted joints require additional cover plates, gusset plates, straps, clip angles and a large number of rivets, which increase the weight. Since there are no such additional parts, welded assembly results in light weight construction. Welded steel structures are lighter than corresponding iron castings lighter than the corresponding iron castings by 50% and steel castings by 30%.

- (ii) Due to the elimination of these components, the cost of welded assembly is lower than that of riveted joints.
- (iii) The design of welded assemblies can be easily and economically modified to meet the changing product requirements. Alternations and additions can be easily made in the existing structure by welding.
- (iv) Welded assemblies are tight and leakproof as compared with riveted assemblies.
- (v) The production time is less for welded assemblies.
- (vi) When two parts are joined by the riveting method, holes are drilled in the parts to accommodate the rivets. The holes reduce the cross-sectional area of the members and result in stress concentration. There is no such problem in welded connections.
- (vii) A welded structure has smooth and pleasant appearance. The projection of rivet head adversely affects the appearance of the riveted structure.
- (viii) The strength of welded joint is high. Very often, the strength of the weld is more than the strength of the plates that are joined together.
- (ix) Machine components of certain shape, such as circular steel pipes, find difficulty in riveting. However, they can be easily welded.

The basic Symbols used to specify the following types of weld :

(i) Fillet



(ii) Square Butt



(iii) Single V-Butt



(iv) Spot



(v) Seam



(vi) Projection



Given,

$$P = 30 \text{ kN},$$


$$\frac{S_{sy}}{FS} = 80 \text{ MPa}$$

Total area of weld

$$A = 2(100t + 150t) = 500t \text{ mm}^2$$

Primary shear stress,

$$\tau_1 = \frac{P}{A} = \frac{30000}{500t} \text{ N/mm}^2 = \frac{60}{t} \text{ N/mm}^2$$

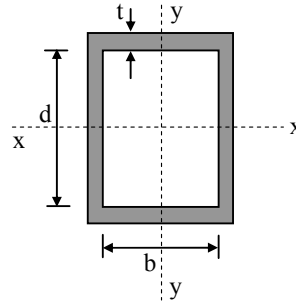

Moment of inertia of weld about x-axis,

$$I_{xx} = 2 \left[\frac{1}{12} \times bt^3 + bt \times \left(\frac{d}{2} \right)^2 \right] + 2 \left(\frac{td^3}{12} \right)$$

Since, b and d are very large compared to 't', t^3 terms are neglected.

$$I_{xx} = bt \times \frac{d^2}{2} + \frac{td^3}{6}$$

$$= t \left[\frac{bd^2}{2} + \frac{d^3}{6} \right]$$

$$\therefore I_{xx} = t \left[\frac{100 \times 150^2}{2} + \frac{150^3}{6} \right] = 75 \times 150^2 \times t \text{ mm}^4$$

Bending stress,

$$\sigma_b = \frac{M}{I_{xx}} \times y$$

$$= \frac{30000 \times 500}{75 \times 150^2 t} \times 75 = \frac{666.66}{t} \text{ N/mm}^2$$

\therefore Maximum shear stress,

$$\tau_{\max} = \sqrt{\left(\frac{\sigma_b}{2} \right)^2 + \tau_1^2}$$

$$= \sqrt{\left(\frac{666.66}{2t} \right)^2 + \left(\frac{60}{t} \right)^2} = \frac{338.69}{t} \text{ N/mm}^2$$

According maximum shear stress theory,

$$\tau_{\max} = \frac{S_{sy}}{FS}$$

$$\frac{338.69}{t} = 80$$

$$\therefore t = 4.23 \text{ mm}$$

$$\therefore \text{Size of weld, } s = \frac{t}{0.707} = \frac{4.23}{0.707} = 5.98 \text{ mm} \approx 6 \text{ mm}$$

04(c). A shaft is subjected to a maximum torque of 10 kN-m and a maximum bending moment of 7.5 kN-m at a particular section. If the allowable equivalent stress in simple tension is 160 MN/m², find the diameter of the shaft according to (i) maximum shear stress theory, (ii) strain energy theory and (iii) shear strain energy theory. Take Poisson's ratio as 0.24.

(20 M)

Sol: Given:

$$T = 10 \text{ kN-m,}$$

$$M = 7.5 \text{ kN-m,}$$

$$S_{yt} = 160 \text{ N/mm}^2, \quad d = ?$$

(i) Maximum shear stress theory:

Equivalent torque,

$$T_{eq} = \sqrt{M^2 + T^2} = \sqrt{7.5^2 + 10^2} = 12.5 \text{ kN-m}$$

Maximum shear stress,

$$\tau_{max} = \frac{16 T_{eq}}{\pi d^3} = \frac{16 \times 12.5 \times 10^6}{\pi \times d^3} \text{ N/mm}^2 = \frac{63.66 \times 10^6}{d^3} \text{ N/mm}^2$$

According to maximum shear stress theory,

$$\tau_{max} = S_{sy} = \frac{S_{yt}}{2}$$

$$\frac{16 \times 12.5 \times 10^6}{\pi d^3} = \frac{160}{2} \Rightarrow d \geq 92.66 \text{ mm}$$

(ii) Maximum strain energy theory:

$$\text{Let } \alpha = \frac{16}{\pi d^3}$$

$$\sigma_1 = \alpha (M + \sqrt{M^2 + T^2}) = 20 \times 10^6 \alpha$$

$$\sigma_2 = \alpha (M - \sqrt{M^2 + T^2}) = -5 \times 10^6 \alpha$$

$$\text{Now, } \sigma_1^2 + \sigma_2^2 - 2\mu\sigma_1\sigma_2 \leq S_{yt}^2$$

$$\alpha^2 \left[(20 \times 10^6)^2 + (5 \times 10^6)^2 + 2 \times 0.24 \times 100 \times 10^{12} \right] \leq 160^2$$

$$\alpha^2 \times 473 \times 10^{12} \leq 160^2$$

$$\Rightarrow \alpha \leq \frac{160}{\sqrt{473 \times 10^{12}}}$$

$$\Rightarrow \alpha \leq 7.3563 \times 10^{-6}$$

$$\Rightarrow \frac{16}{\pi d^3} \leq 7.356 \times 10^{-6}$$

$$\Rightarrow d \geq 88.48 \text{ mm}$$

(iii) Shear strain energy theory or von-Mises theory:

$$\sigma_1^2 + \sigma_2^2 - \sigma_1\sigma_2 \leq S_{yt}^2$$

$$\frac{10^6}{d^3} \sqrt{101.855^2 + 25.4^2 + 101.855 \times 25.4} \leq 160$$

$$d \geq 90 \text{ mm}$$



ACE[®]
 Engineering Academy
 Leading Institute for ESE/GATE/PSUs



Hyderabad | Ahmedabad | Pune | Delhi | Bhopal | Bhubaneswar | Bangalore | Patna | Chennai | Lucknow | Visakhapatnam | Vijayawada | Tirupati | Kolkata

@Hyderabad

New Batches for
GENCO / TRANSCO / DISCOMS

@ Hyderabad

ELECTRICAL ENGINEERING

Batch Dates

29th June & 14th July 2019

Duration : **5 to 6 Months** • Timings : **4 to 6 hrs** • Fee : **45000/-** • Venue : **ABIDS**

It's exclusive for Power Generation Corporation & Power Distribution Company's of all states in India

Syllabus Included

(a). General Aptitude,
(b). Technical Subjects (as per GATE Syllabus Except Mathematics)



Scan QR Code
 for More Information

Web: www.aceenggacademy.com | Call: **040-23234418/19/20**

SECTION - B

05(a). Describe the following microconstituents of iron-carbon alloys in relation to the phases present, arrangement of phases and their relative mechanical properties:

- (a) Spheroidite**
- (b) Pearlite**
- (c) Bainite**
- (d) Martensite**

(12 M)

Sol: Phase transformations and mechanical properties for iron-carbon alloys

Several different microstructures that may be produced in iron-carbon alloys depending on heat treatment. Figure summarizes the transformation paths that produce these various microstructures. Here, it is assumed that Pearlite, Bainite, and Martensite result from continuous-cooling treatments; furthermore, the formation of Bainite is possible only for alloy steels (not plain carbon ones).

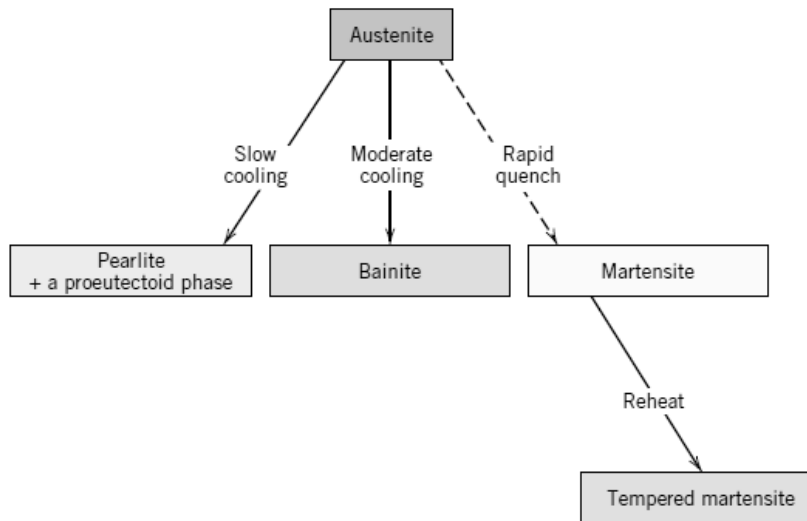


Figure Possible transformations involving the decomposition of austenite. Solid arrows, transformations involving diffusion; dashed arrow, diffusionless transformation.

Microstructural characteristics and mechanical properties of the several microconstituents for iron-carbon alloys are summarized in Table.

Microconstituent	Phases Present	Arrangement of Phases	Mechanical Properties (Relative)
Spheroidite	α -Ferrite + Fe_3C	Relatively small Fe_3C spherulike particles in an α -ferrite matrix	Soft and ductile
Coarse pearlite	α -Ferrite + Fe_3C	Alternating layers of α -ferrite and Fe_3C that are relatively thick	Harder and stronger than spheroidite, but not as ductile as spheroidite
Fine pearlite	α -Ferrite + Fe_3C	Alternating layers of α -ferrite and Fe_3C that are relatively thin	Harder and stronger than coarse pearlite, but not as ductile as coarse pearlite
Bainite	α -Ferrite + Fe_3C	Very fine and elongated particles of Fe_3C in an α -ferrite matrix	Harder and stronger than fine pearlite; less hard than martensite; more ductile than martensite
Tempered martensite	α -Ferrite + Fe_3C	Very small Fe_3C spherulike particles in an α -ferrite matrix	Strong; not as hard as martensite, but much more ductile than martensite
Martensite	Body-centered, tetragonal, single phase	Needle-shaped grains	Very hard and very brittle

Table: Microstructures and Mechanical Properties for Iron–Carbon Alloys

05(b). In an orthogonal cutting operation, the cutting speed is 2.5 m/s, rake angle is 6° and the width of cut is 10 mm. The underformed chip thickness is 0.2 mm. 13.36 grams of steel chips with total length of 50 cm are obtained. The tool post dynamometer gives cutting and thrust forces as 1134 N and 453.6 N respectively. Find

(i) shear plane angle;

(ii) friction energy at tool-chip interface as percentage of total energy;

(iii) specific cutting energy.

Assume density of steel = 7.8 grams/cm^3 . (12 M)

Sol: Given data:

Orthogonal cutting operation:

Cutting speed (V) = 2.5 m/sec

Rake angle (α) = 6°

Width of cut (W) = 10 mm

Uncut chip thickness (t_1) = 0.2 mm

Mass (or) weight of chip obtained (Wt) = 13.36 grams

l_c = chip length = 50 cm

Density of steel (ρ) = 7.8 grams/cm^3

Cutting force (F_C) = 1134 N

Thrust force (F_T) = 453.6 N

Find:

(i) Shear plane angle (ϕ)

(ii) friction energy at tool chip interface as % of total energy

(iii) specific cutting energy

Density of steel (ρ) = Mass / Volume = 7.8 grams/cm³

$$\therefore \text{Volume} = W t_2 l_c = \text{Mass} / \text{Density} = \frac{13.36}{7.8} = 1.713 \text{ cm}^3$$

$$\therefore W t_2 l_c = 1.713$$

$$t_2 = 1.713 \times 10^3 / 10 \times (50 \times 10) = 0.343 \text{ mm}$$

$$\therefore t_1 = 0.2 \text{ mm}, \quad t_2 = 0.343 \text{ mm}$$

$$r = t_1 / t_2 = 0.2 / 0.343 = 0.584$$

Chip thickness ratio (or) cutting ratio (r) = 0.584

$$(i) \text{ Shear plane angle } \phi = \tan^{-1} \left(\frac{r \cos \alpha}{1 - r \sin \alpha} \right)$$

$$\therefore \phi = \tan^{-1} \left(\frac{0.584 \cos 6^\circ}{1 - 0.584 \sin 6^\circ} \right)$$

$$\phi = 31.74^\circ$$

Total energy (P_{cutting}) = $F_c \cdot V = 1134 \times 2 = 2268 \text{ Watt}$

$$\text{Chip thickness ratio } (r) = \frac{V_c}{V}$$

V_c (chip flow velocity) = $r \cdot V = 0.584 \times 2 = 1.168 \text{ m/sec}$

$F = F_T \cos \alpha + F_c \sin \alpha$ (From Merchant's circle)

Friction force (F) = $453.6 \cos 6^\circ + 1134 \sin 6^\circ$

$$F = 569.65 \text{ N}$$

Friction energy (P_{friction}) = $F \cdot V_c = 569.65 \times 1.168 = 665.35 \text{ Watt}$

$$(ii) \frac{P_{\text{friction}}}{P_{\text{total}}} = \frac{665.35}{2268} = 0.293$$

\therefore 29.3% of total energy is used as friction energy.

$$(ii) \text{ Specific cutting energy} = \frac{P_{\text{cutting}}}{\text{MRR}}$$

$$= \frac{F_c \cdot V}{w t_1 V} = \frac{F_c}{w t_1} = \frac{1134}{10 \times 0.2}$$

Specific cutting energy = 567 N/mm²

05(c). Describe four tests of flexibility that an automated manufacturing system should satisfy to qualify as being flexible. Also list the application areas where FMS technology is successfully employed. (12 M)


Sol: To qualify as being flexible, an automated manufacturing system should satisfy the following four tests of flexibility:

1. *Part-variety test.* Can the system process different part or product styles in a mixed model (non-batch) mode?
2. *Schedule-change test.* Can the system readily accept changes in production schedule, that is, changes in part mix and/or production quantities?
3. *Error-recovery test.* Can the system recover gracefully from equipment malfunctions and breakdowns, so that production is not completely disrupted?
4. *New-part test.* Can new part designs be introduced into the existing part mix with relative ease if their features qualify them as being members of the part family for which the system was designed? Also, can design changes be made in existing parts without undue challenge to the system?

If the answer to all of these questions is “yes” for a given manufacturing system, then the system is flexible. The most important tests are (1) and (2). Test (3) is applicable to multi-machine systems but in single-machine systems when the one machine breaks down it is difficult to avoid a halt in production. Test (4) would seem to not apply to systems designed for a part family whose members are all known in advance. However, such a system may have to deal with design changes to members of that existing part family.

Applications of Flexible Manufacturing Systems

Flexible manufacturing systems are typically used for mid-volume, mid-variety production. If the part or product is made in high quantities with no style variations, then a transfer line or similar dedicated production system is most appropriate. If the parts are low volume with high variety, then numerical control, or even manual methods would be more appropriate. These application characteristics are summarized in Figure below.

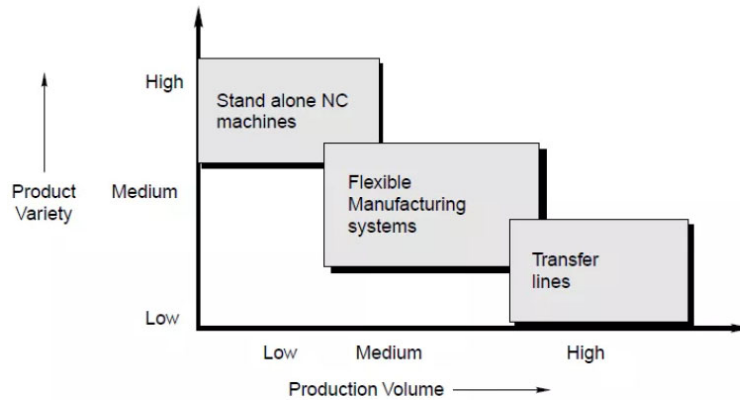

Application characteristics of FMS

Flexible machining systems comprise the most common application of FMS technology. Owing to the inherent flexibilities and capabilities of computer numerical control, it is possible to connect several CNC machine tools to a small central computer, and to devise automated methods for transferring workparts between the machines.

In addition to machining systems, other types of flexible manufacturing systems have also been developed, although the state of technology in these other processes has not permitted the rapid implementation that has occurred in machining. The other types of systems include assembly, inspection, sheet-metal processing (punching, shearing, bending, and forming), and forging. Most of the experience in flexible manufacturing systems has been gained in machining applications.

05(d). Describe at least five main functions carried out by coating on electrode in electric arc welding process. Also, list the constituents of coating and their purpose. (12 M)

Sol: Function of coating on electrodes

- (1) The coatings produce a reducing or nonoxidizing atmosphere around the arc; thus, preventing the contamination of the metal in the arc by oxygen and nitrogen from the air.
- (2) The coatings reduce impurities such as oxides, sulphur, and phosphorous so that these impurities will not impair the weld deposit.
- (3) They provide substance to the arc, which tend to increase its stability, so that the arc can be maintained without excessive spattering and which can initiate the arc easily
- (4) Coatings converges the arc and reduce convective heat transfer from the arc
- (5) They controls the fluidity of the molten metal and slag.
- (6) On melting they form the slag a bad conductor of heat and prevents hardening of weld bead.

Constituents of coating and their purpose

Various constituents of electrode coating are cellulose, calcium fluoride, calcium carbonate, titanium dioxide, clay, talc, iron oxide, asbestos, potassium / sodium silicate, iron powder, ferromanganese, powdered alloys, silica etc. Each constituent performs either one or more than one functions.

Electrode metallic core wire is the same but the coating constituents give the different characteristics to the welds. Based on the coating constituents, structural steel electrodes can be classified in the following classes;

1. Cellulosic Electrodes

Coating consists of high cellulosic content more than 30% and TiO_2 up to 20%. These are all position electrodes and produce deep penetration because of extra heat generated during burning of cellulosic materials. However, high spatter losses are associated with these electrodes.

2. Rutile Electrodes

Coating consists of TiO_2 up to 45% and SiO_2 around 20%. These electrodes are widely used for general work and are called general purpose electrodes.

3. Acidic Electrodes


Coating consists of iron oxide more than 20%. Sometimes it may be up to 40%, other constituents may be TiO_2 10% and CaCO_3 10%. Such electrodes produce self detaching slag and smooth weld finish and are used normally in flat position.

4. Basic Electrodes

Coating consist of CaCO_3 around 40% and CaF_2 15-20%. These electrodes normally require baking at temperature of approximately 250°C for 1-2 hrs or as per manufacturer's instructions. Such electrodes produce high quality weld deposits which has high resistance to cracking. This is because hydrogen is removed from weld metal by the action of fluorine i.e. forming HF acid as CaF_2 generates fluorine on dissociation in the heat of arc.

The major constituents and their functions are listed here under

Coating Constituent	Purpose	Function
Cellulose	Gas former	Coating Strength and Reducing agent
Calcium Fluoride (CaF ₂)	Slag basicity and metal fluidity, H ₂ removal	Slag former
Clay (Aluminum Silicate)	Slag former	Coating strength
Talc (Magnesium Silicate)	Slag former	Arc stabilizer
Rutile (TiO ₂)	Arc stabilizer, Slag former, Fluidity	Slag removal and bead appearance
Iron Oxides	Fluidity, Slag former	Arc Stabilizer, improved metal transfer,
Calcium Carbonate	Gas former, Arc stabilizer	Slag basicity, Slag former
Asbestos	Coating strength	Slag former
Quartz (SiO ₂)	Slag fluidity, Slag former	Increase in current carrying capacity.
Sodium Silicate / Potassium Silicate	Binder, Arc stabilizer	Slag former
FeMn / FeSi	Deoxidizer	-
Iron Powder	Deposition Rate	-
Powdered Alloys	Alloying	-

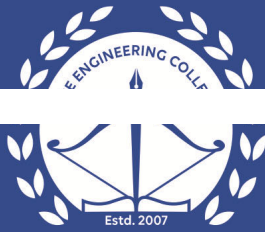

ACE

Engineering College
(Approved by AICTE & Affiliated to JNTUH)



Scan for Experts' Advice

@ GHATKESAR, HYDERABAD



B.Tech : CSE* IT ECE* CIVIL MECH* EEE*



Separate Hostel Facility for Boys & Girls


EDC | Guidance for GATE and ESE |
Centre of Excellence in AI / ML, IoT and JHUB



Why ACE?

THE BUTTERFLY

Skill Development & Employability Program

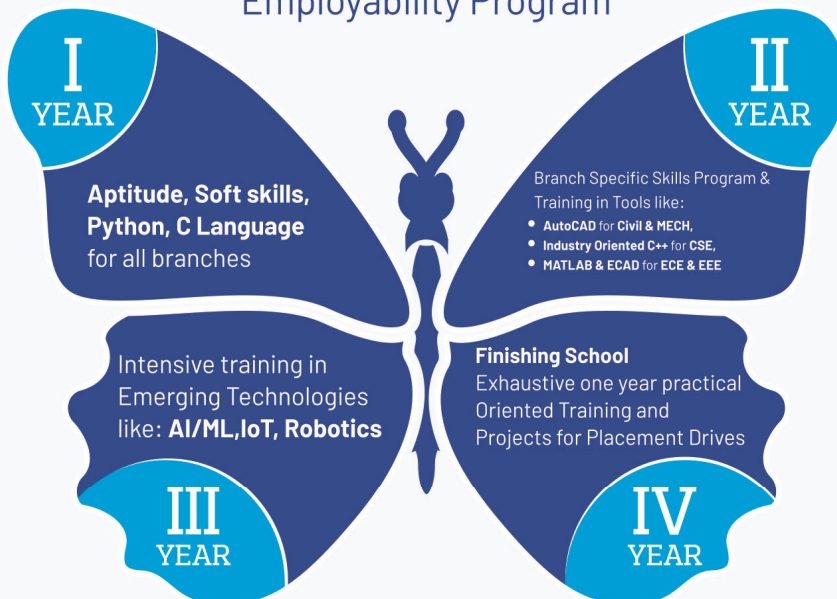

OUR PROMINENT RECRUITERS (A.Y. 2018-19)

INFOSYS	MU SIGMA	VIRTUSA
WIPRO	COGNIZANT	OPENTEXT
TCS	CYIENT	JIO
OPTUM	HITACHI	XTREAMIT
AAIC	AMAZON	HEXAWARE
XIAOMI	HP	GGK TECH
MINDTREE	TECH MAHINDRA	OPTUMRX
MI	CAPGEMINI	CORECOMPETE
SPIDERS	IBM	EPAM
SYNTEL	VALUEMOMENTUM	NINELEAPS

and many more...

More than **80%**

PLACEMENTS

of Registered Candidates

📞 9133308468, 9912391169, 9133308533

Email: admissions2019@aceec.ac.in | website: www.aceec.ac.in

05(e). Explain the distinction between the following using block diagrams and examples:

(i) Measurement systems and Control systems


(ii) Open-loop systems and Closed-loop systems.

(6 +6 = 12 M)

Sol:

(i) Distinction between measurement systems and control systems.

Measurement system consist of three basic elements as shown block diagram

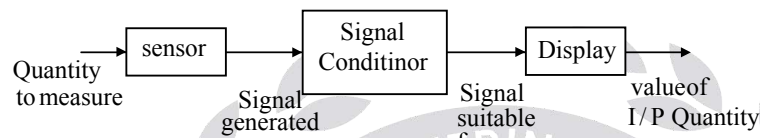

(i) Sensor: Measure the input quantity and generate output signal related to input quantity.

Ex: Thermo couple, Input quantity is temperature, output is emf (voltage),

(ii) Signal conditioner is a circuit manipulate into suitable form for display.

Ex: amplifier circuit, amplify small voltage (mv (or) μv) to large value (volts)

(iii) Display: Indicator (or) digital display of output.

Ex: Pointer moving on scale for Analog display, 7-segment display for digital display.

So example of measurement system is digital thermometer, measure temperature and display its value.

Control system includes measurement system and controller and other necessary parts for control some variable at set value.

Ex: Temperature is controlled in central air conditioning system at set value.

Control system also used to control sequence of events.

Ex: Washing machine,

 
Pre wash cycle \rightarrow main wash cycle \rightarrow rinse cycle \rightarrow spinning

In conclusion: Measurement system is a part of control system.

(ii) Open loop systems and closed loop systems.


Control systems are mainly two basic types as (i) open loop systems (ii) closed loop systems to control any parameter at particular set value.

Open loop system block diagram is




Ex: domestic toaster

 Bread is toasted by setting a timer, how much time to toast the bread. In this no feed back and measurement. So, it is simple, with low cost;



Ex: Heating room with open-loop system.

→ Closed loop system block diagram is

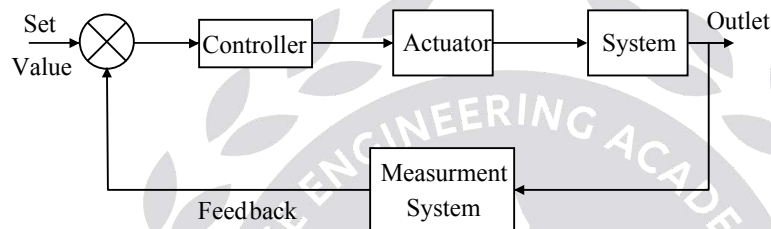

Several examples in industries as control of temperature, pressure in boiler and so on.

Closed loop systems are more accurate, and preferable when load changes are frequent. But it is complex and costly compared with open loop systems.

06(a).

- (i) In an open die forging, a strip 150 mm wide, 400 mm long and 10 mm thick is compressed in plane strain such that the dimension 400 remains same. The yield strength of material in uniaxial compression is equal to 200 N/mm². Find the minimum, average and maximum die pressures at the beginning of plastic deformation if the coefficient of friction on the interface between the die and the material is equal to 0.1. (10 M)

Sol: Given data :

Open die forging

Strip size = 150 mm × 4 mm × 10 mm

Yield strength $(\sigma_y) = 200 \text{ N/mm}^2$

Coefficient of friction $(\mu) = 0.1$

Length of outer edge from centre of strip, $(L) = \frac{b}{2} = \frac{150}{2} = 75 \text{ mm}$

Sticking zone length, $(x_s) = L - L - \frac{h}{2\mu} \ln\left(\frac{1}{2\mu}\right)$

$$x_s = 75 - \frac{10}{2 \times 0.1} \ln\left(\frac{1}{2 \times 0.1}\right)$$

$$x_s = -5.47 \text{ (so there is only sliding zone)}$$

Sliding zone $0 \leq x \leq 75 \text{ mm}$

Pressure variation in sliding zone is given by, $P = 2ke^{\frac{2\mu}{h}(L-x)}$

Where $k = \frac{\sigma_y}{\sqrt{3}}$ (from von Mises theory)

$$k = \frac{200}{\sqrt{3}} = 115.47 \text{ N/mm}^2$$

$$P_{\max} = 2 \times 115.47 e^{\frac{2 \times 0.1}{10} \times 75} = 1035 \text{ N/mm}^2$$

Minimum pressure is at $x = L$, i.e.,

$$P_{\min} = 2ke^0 = 2k = 230.94 \text{ N/mm}^2$$

$$P_{\min} = 230.94 \text{ N/mm}^2$$

Mean pressure (P_{mean}):

$$P_{\text{mean}} \times L = \int_0^L P dx$$

$$P_{\text{mean}} \times 75 = \int_0^{75} 2ke^{\frac{2\mu}{h}(L-x)} dx = 40203.06$$

$$P_{\text{mean}} = 536.04 \text{ N/mm}^2$$

06(a). (ii) For a product, the purchase prices are given below :

Sl. No.	Order Quantity (Q_i)	Unit Prices (Rs)
1	$Q_1 < 500$	10.00
2	$500 \leq Q_2 < 750$	9.25
3	$Q_3 \geq 750$	8.75

Determine the optimum purchase quantity if the annual demand of the product is 2400 units. The cost of ordering is Rs.100 and the inventory carrying charge is 24% of the purchase price per year. (10 M)

Sol: Annual demand (D) = 2400 units

Order cost $(C_o) = \text{Rs. } 2100$

Carrying cost $(C_c) = 24\%$ of unit cost per year

Let $C_u = \text{Rs. } 8.75$

$$EOQ|_{C_u=8.75} = \sqrt{\frac{2DC_o}{C_c}} = \sqrt{\frac{2 \times 2400 \times 100}{0.24 \times 8.75}} = 478 \text{ units}$$

The calculated 'EOQ' does not satisfy the quantity range. Hence, this value is discarded.

$$\begin{aligned} TC|_{\substack{Q_3=750 \\ C_u=8.75}} &= \frac{Q_3}{2} \times C_c + \frac{D}{Q_3} \times C_o + D \times C_u \\ &= \frac{750}{2} \times 0.24 \times 8.75 + \frac{2400}{750} \times 100 + 2400 \times 8.7 = 22107.50 \end{aligned}$$

Let $C_u = 9.25$

$$EOQ|_{C_u=9.25} = \sqrt{\frac{2 \times 2400 \times 100}{0.24 \times 9.25}} = 464.9 \text{ units}$$

The EOQ does not satisfy the quantity range

$$TC|_{\substack{Q_2=500 \\ C_u=9.25}} = \frac{500}{2} \times 0.24 \times 9.25 + \frac{2400}{500} \times 100 + 2400 \times 9.25 = \text{Rs. } 23235/-$$

Let $C_u = 10$

$$EOQ|_{C_u=10} = \sqrt{\frac{2 \times 2400 \times 100}{0.24 \times 10}} = 447.2 \text{ units}$$

$$\begin{aligned} TC|_{\substack{EOQ=447.2 \\ C_u=10}} &= \sqrt{2DC_oC_c} + D \times C_u \\ &= \sqrt{2 \times 2400 \times 100 \times 0.24 \times 10} + 2400 \times 10 = \text{Rs. } 25073/- \end{aligned}$$

Order Quantity	Total cost
Q = 750	22107/-
Q = 500	23235/-
EOQ = 447.2	25073/-

Optimum (Best) order quantity = 750 units.



www.aceenggacademy.com




ACE
Engineering Academy
Leading Institute for ESE/GATE/PSUs

GATE 48
All India 1st Ranks

ESE 11
All India 1st Ranks

LAUNCHING



DIGITAL CLASSES
for **GENERAL STUDIES & ENGINEERING APTITUDE - ESE**

New Batches @ HYDERABAD

GATE+PSUS - 2020 Regular Batches : 24 th June, 01 st , 08 th , 22 nd July, 5 th & 20 th Aug 2019 Spark Batch : 24 th June, 2019	GATE+PSUS - 2021 Morning & Evening Batches : 12 th July & 10 th August 2019
ESE+GATE+PSUS - 2020 Spark Batch : 24 th June, 2019 Regular Batches : 24 th June & 8 th July 2019 General Studies Batch : 12 th July 2019	ESE+GATE+PSUS - 2021 Morning Batches : 12 th July & 10 th August 2019
	GENCO / TRANSCO : 29 th June 2019

OUR GATE - 2019 TOPPERS

AIR 1 FRANCIAR SINGH CE	AIR 1 SRIHARISHANKAR PI	AIR 1 RAJAT SONI EE	AIR 1 PRANAY SHANKAR CSIT	AIR 1 SHASHANK MANIHAL IN
AIR 2 KUNAL G. EE	AIR 2 MUKESH POKHRA EE	AIR 2 ANAND DEEPAK EC	AIR 2 PRITHVIA KUPPA IN	AIR 2 ASLAM PI
AIR 3 ANISH KOLHANE ME	AIR 3 RISHI MANOHARNA CE	AIR 3 DEEPIKHA MARUDU EC	AIR 3 PRATEEK AGARWAL CSIT	AIR 3 VINAY GOPALAM IN
AIR 3 SOURABH PI	AIR 3 SOURABH PI	AIR 3 SOURABH PI	AIR 3 SOURABH PI	AIR 3 SOURABH PI

and many more...

OUR ESE - 2018 TOP RANKERS

AIR 1 SHASHANK E&T	AIR 1 CHIRAG JHA EE	AIR 1 VINAY PRAKASH CE	AIR 1 AMAN JAIN ME
--------------------------	---------------------------	------------------------------	--------------------------

and many more...

TOTAL SELECTIONS : 350 | E&T : 89 | EE : 80 | CE : 92 | ME : 89

HEAD OFFICE

4-1-1236/1/A, Sindhu Sadan, King Koti, Abids, Hyderabad - 500001.

☎ 040-23234418, 19, 20, 040-24750437

✉ hyderabad@aceenggacademy.com

www.aceenggacademy.com

DILSUKH NAGAR : 040-40044451, 40209345

KUKATPALLY : 040-40199966, 93476 99966

KOTHAPET : 040 - 24034418/19

TO WIN THE RACE.. JOIN ACE...



Scan for New Batches

HYDERABAD | AHMEDABAD | DELHI | BHOPAL | PUNE | BHUBANESWAR | LUCKNOW | PATNA | BENGALURU | CHENNAI | VIJAYAWADA | VIZAG | TIRUPATHI | KOLKATA

 with 3.20 CGPA	 B.Tech Courses*	 Estd. 2007	ACE Engineering College (Approved by AICTE & Affiliated to JNTUH)	EAMCET CODE ACEG
📍 Ghatkesar, Hyderabad ☎ 9133308468, 9912391169, 9133308533 ✉ aceenggcollege@gmail.com 🌐 www.aceec.ac.in				
 <p>On-Campus Hostel Facility for Boys & Girls</p>				

Sponsored by : Yadala Satyanarayana Memorial Educational Society | Powered by : ACE Engineering Academy (Leading Institute for ESE / GATE / PSUs)

COURSES OFFERED B.Tech (UG) **CSE*** 180 **ECE*** 180 **CIVIL** 120 **MECH*** 120 **EEE*** 60 **IT**** 60

WHY ACE..?

The Butterfly
Skill Development & Employability Program

I YEAR Aptitude, Soft skills, Python, C Language for all branches	II YEAR Branch Specific Skills Program & Training in Tools like: • AutoCAD for CIVIL & MECH • Industry Oriented CIVIL & ECE • MATLAB & CAD for EEE & ECE
III YEAR Intensive training in Emerging Technologies like: AI/ML, IoT, Robotics	IV YEAR Finishing School Exhaustive one year practical Oriented Training and Projects for Placement Drives

Entrepreneurship Development Cell | Guidance for GATE, GRE, TOEFL, GMAT and CAT
Centre of Excellence in AI / ML, IoT and JHUB | National Service Scheme (NSS)

Department Technical Clubs: • CIVIL-Sponsors • EEE-Phasor • MECH-Mechazays • ECE-Tektronix • CSE-Dynamics

 PLACEMENTS AND ADMIN BLOCK	 CENTRAL LIBRARY	 FULLY MECHANIZED CANTEEN
OUR EMINENT RECRUITERS (A.Y. 2018-19) • TCS - 21 • Wipro - 18 • Amazon - 16 • Cognizant - 13 • Cyient - 03 • Xiaomi - 31	INDUSTRY ASSOCIATION WITH • AICTE-BENNET University • Microsoft Innovation Centre • TCS-ION Program • HCL Technologies Pvt.Ltd. • Larsen Toubro (L&T)	and many more.. • Mu Sigma - 01 • Hitachi - 02 • AAIIC - 05 • Infosys - 01 • Optum - 03 • Cyient • Aspiring Minds • CoCubes • eLitmus • TASK and many more..
 GIRLS HOSTEL	 1000+ SEATING CAPACITY AUDITORIUM	 BOYS HOSTEL

06(b). What is a eutectoid reaction? Explain the development of microstructure in iron-carbon alloys of hypoeutectoid, eutectoid and hypereutectoid compositions when they are cooled from high temperature with the help of neatly labelled diagrams indicating the phases present. (20 M)

Sol: Eutectoid reaction: A reaction in which, upon cooling, one solid phase transforms isothermally and reversibly into two new solid phases that are intimately mixed.

DEVELOPMENT OF MICROSTRUCTURE IN IRON-CARBON ALLOYS

An alloy of *eutectoid composition* (0.76 wt% C) as it is cooled from a temperature within the γ -phase region, say, 800°C —that is, beginning at point *a* in Figure 1 and moving down the vertical line *xx'*:

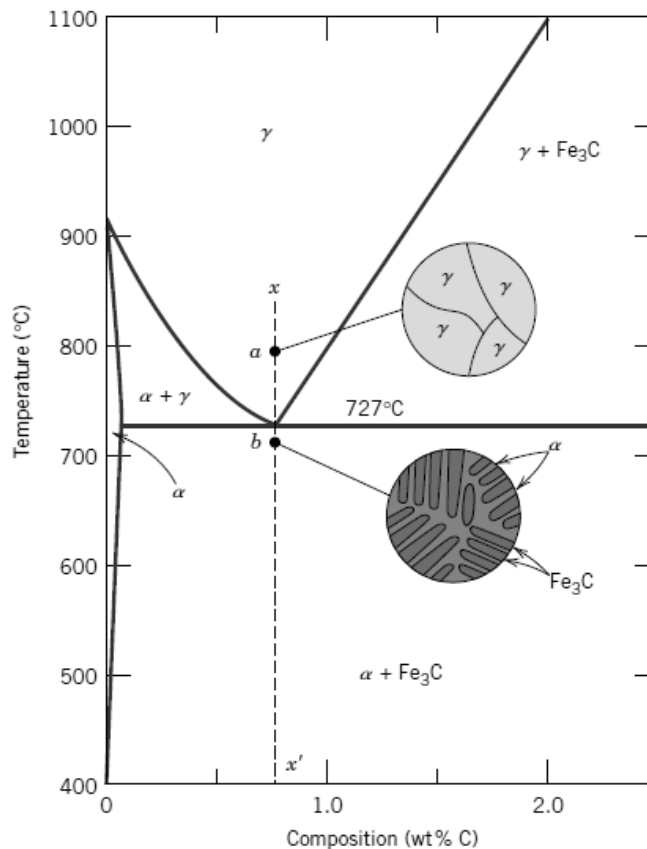


Figure 1: Schematic representations of the microstructures for an iron– carbon alloy of eutectoid composition (0.76 wt% C) above and below the eutectoid temperature.

Initially, the alloy is composed entirely of the austenite phase having a composition of 0.76 wt% C and corresponding microstructure, also indicated in Figure 1. As the alloy is cooled, no changes occur until the eutectoid temperature (727°C) is reached. Upon crossing this temperature to point b the austenite transforms.

The microstructure for this eutectoid steel that is slowly cooled through the eutectoid temperature consists of alternating layers or lamellae of the two phases (α and Fe_3C) that form simultaneously during the transformation. In this case, the relative layer thickness is approximately 8 to 1. This microstructure, represented schematically in Figure 1, point b , is called **pearlite** because it has the appearance of mother-of pearl when viewed under the microscope at low magnifications.

Hypoeutectoid Alloys :

Consider a composition C_0 to the left of the eutectoid, between 0.022 and 0.76 wt% C; this is termed a **hypoeutectoid** (“less than eutectoid”) **alloy**. Cooling an alloy of this composition is represented by moving down the vertical line yy' in Figure. At about 875°C , point c , the microstructure consists entirely of grains of the γ phase, as shown schematically in the figure.

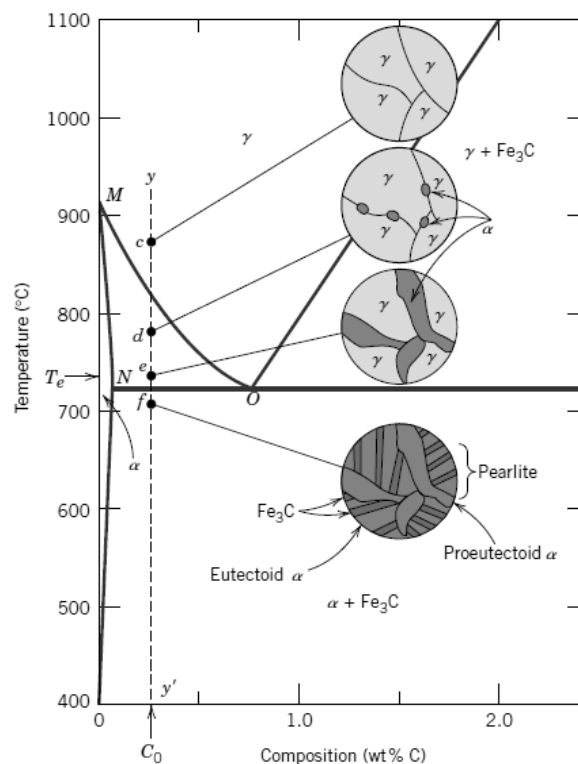


Figure : Schematic representations of the microstructures for an iron– carbon alloy of hypoeutectoid composition C_0 (containing less than 0.76 wt % C) as it is cooled from within the austenite phase region to below the eutectoid temperature.

In cooling to point d , about 775°C , which is within the $\alpha + \gamma$ phase region, both these phases coexist as in the schematic microstructure. Most of the small α particles form along the original γ grain boundaries. The compositions of both α and γ phases may be determined using the appropriate tie line; these compositions correspond, respectively, to about 0.020 and 0.40 wt % C.

While cooling an alloy through the $\alpha + \gamma$ phase region, the composition of the ferrite phase changes with temperature along the $\alpha - (\alpha + \gamma)$ phase boundary, line MN , becoming slightly richer in carbon. However, the change in composition of the austenite is more dramatic, proceeding along the $(\alpha + \gamma) - \gamma$ boundary, line MO , as the temperature is reduced.

Cooling from point d to e , just above the eutectoid but still in the $\alpha + \gamma$ region, produces an increased fraction of the α phase and a microstructure similar to that also shown: the α particles will have grown larger. At this point, the compositions of the α and γ phases are determined by constructing a tie line at the temperature T_e ; the α phase contains 0.022 wt % C, whereas the γ phase is of the eutectoid composition, 0.76 wt % C. As the temperature is lowered just below the eutectoid, to point f , all of the γ phase that was present at temperature T_e (and having the eutectoid composition) transforms into pearlite. There is virtually no change in the α phase that existed at point e in crossing the eutectoid temperature—it is normally present as a continuous matrix phase surrounding the isolated pearlite colonies. The microstructure at point f appears as the corresponding schematic inset of Figure 2.

Thus the ferrite phase is present both in the pearlite and as the phase that formed while cooling through the $\alpha + \gamma$ phase region. The ferrite present in the pearlite is called *eutectoid ferrite*, whereas the other, which formed above T_e , is termed **proeutectoid** (meaning “pre- or before eutectoid”) **ferrite**, as labeled in Figure 4.

Hypereutectoid Alloys :

Analogous transformations and microstructures result for **hypereutectoid alloys** those containing between 0.76 and 2.14 wt % C—that are cooled from temperatures within the γ -phase field.

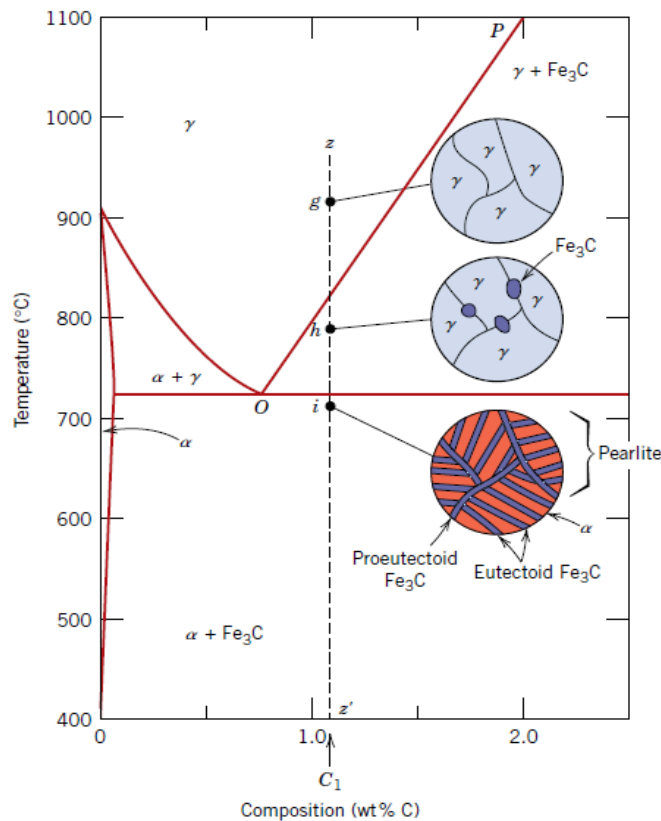


Figure 3: Schematic representations of the microstructures for an iron–carbon alloy of hypereutectoid composition C_1 (containing between 0.76 and 2.14 wt % C) as it is cooled from within the austenite-phase region to below the eutectoid temperature.

Since 1995

Consider an alloy of composition C_1 in Figure that, upon cooling, moves down the line zz' . At point g , only the γ phase is present with a composition of C_1 ; the microstructure appears as shown, having only γ grains. Upon cooling into the $\gamma + \text{Fe}_3\text{C}$ phase field - say, to point h - the cementite phase begins to form along the initial γ grain boundaries, similar to the α phase in Figure, point d . This cementite is called **proeutectoid cementite** that which forms before the eutectoid reaction. The cementite composition remains constant (6.70 wt % C) as the temperature changes.

However, the composition of the austenite phase moves along line PO toward the eutectoid. As the temperature is lowered through the eutectoid to point i , all remaining austenite of eutectoid composition is converted into pearlite; thus, the resulting microstructure consists of pearlite and proeutectoid cementite as microconstituents .

06(c).

(i) Describe, with neat sketches, the working principle of


(1) linear variable differential transformer (LVDT);

(2) Hall effect sensor.

(5 + 5 = 10 M)

Sol:

1. **Linear Variable Differential Transformer (LVDT):** It is an electrical passive transducer, used to measure small linear displacements.

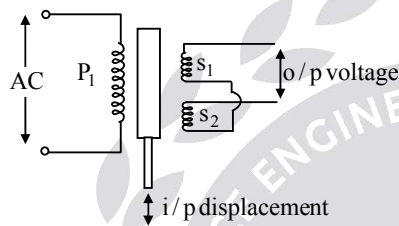


It consists of 3 coils (1 Primary coil, excited with AC voltage) & (2 secondary coils, connected in opposition and generate output voltage) and magnetic core.

When input displacement is applied to the magnetic core, it induces voltages in two secondary coils (S_1) & (S_2).

The difference between two secondary coils (S_1 & S_2) is proportional to input displacements up to small displacements (± 5 mm). Its operating range is ± 2 mm to ± 400 mm displacements.

2. **Hall effect sensors:** It is a proximity sensor, used to detect position (or) displacement of a moving object without any contact.

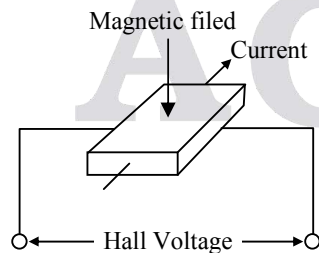

If a thin strip of current-carrying material is subjected to a transverse magnetic field, then a Hall voltage is generated between opposite edges of the strip.

So, the generated voltage output is

$$V_{\mu} = K_{\mu} \frac{IB}{t}$$

V_{μ} = Hall voltage output generated,

K_H is Hall coefficient, depends on selected strip material,

I is constant current

B is majestic flux density at rigid Angles to the strip plate.

t is thickness of plate.

The sensor is available in Integrated Circuit (IC) form. Its output Hall voltage is proportional to majestic flux density, which depends on input position (or) displacement of moving object.

- (ii) A measurement system consists of a cylindrical load cell of diameter 2.5 mm. The material of the cell is steel with modulus of elasticity, $E = 210$ GPa and Poisson's ratio, $\gamma = 0.3$. This carries four strain gauges each with gauge factor 2.1. Two of them are mounted longitudinal and other two are transverse. The resistances of the gauges are 120Ω . This load cell is required to yield a voltage through the bridge of strain gauges with bias 10 V. If the maximum load sustained by the cell is -2500 N, what is the corresponding voltage across the bridge?

(10 M)

Sol: Measurement system consist of

- Cylindrical load cell of diameter = 2.5 mm,
- Steel with $E = 210$ GPa, $\gamma = 0.3$
- 4 strain gauges with G.F = 2.1, $R = 120 \Omega$,
- 2 longitudinal direction and 2 transverse direction.
- Excitation = 10 V, max load = 2500 N,

What is V_0 (output voltage)?

$$\text{Its output voltage } V_0 = (1 + \nu) \frac{G_f \cdot \epsilon \cdot V}{2}$$



With Young's modulus

$$E = \frac{\text{Stress}}{\text{Strain}(\epsilon)} = \frac{F/A}{\epsilon}$$

$$\text{So strain } (\epsilon) = \frac{F}{A} \times \frac{1}{E}$$

$$= \frac{2500}{\pi(1.25 \times 10^{-3})^2} \times \frac{1}{250 \times 10^9}$$

$$\epsilon = 2.037 \times 10^{-3}$$

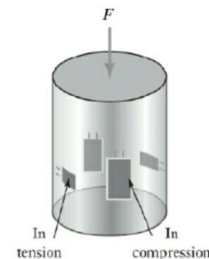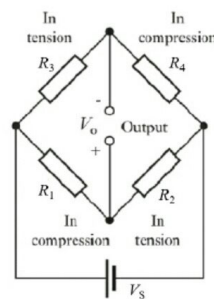

Then, $V_0 = (1 + \nu) \frac{G_f \cdot \varepsilon \cdot V}{2}$

$\nu = \text{Poisson's ratio} = 0.3$

$G_f = \text{Gauge factor} = 2.1$

$\varepsilon = \text{strain} = 2.037 \times 10^{-3}$

$V = \text{excitation} = 10 \text{ V}$

$$V_0 = \frac{(1 + 0.3)(2.1)(2.037 \times 10^{-3})(10 \text{ V})}{2} = 0.0278 \text{ Volt}$$

07(a).

- (i). On the basis of microstructure, briefly explain why gray iron is brittle and weak in tension. Compare gray and malleable cast irons with respect to (1) composition and heat treatment, (2) microstructure and (3) mechanical properties. (10 M)**

Sol: Gray iron is weak and brittle in tension because the tips of the graphite flakes act as points of stress concentration.

This question asks us to compare various aspects of gray and malleable cast irons.

- (a) With respect to composition and heat treatment:

Gray iron: 2.5 to 4.0 wt% C and 1.0 to 3.0 wt% Si. For most gray irons there is no heat treatment after solidification.

Malleable iron: 2.5 to 4.0 wt% C and less than 1.0 wt% Si. White iron is heated in a non-oxidizing atmosphere and at a temperature between 800 and 900°C for an extended time period.

- (b) With respect to microstructure:

Gray iron: Graphite flakes are embedded in a ferrite or pearlite matrix.

Malleable iron: Graphite clusters are embedded in a ferrite or pearlite matrix.

- (c) With respect to mechanical characteristics:

Gray iron: Relatively weak and brittle in tension; good capacity for damping vibrations.

Malleable iron: Moderate strength and ductility.

- (ii) Cite three sources of internal residual stresses in metal components. What are two possible adverse consequences of these stresses? Describe the following heat treatment procedures for steels and for each, the intended final microstructure:**

Full annealing, Normalizing, Tempering and Quenching. (10 M)

Sol: Three sources of residual stresses in metal components are plastic deformation processes, non-uniform cooling of a piece that was cooled from an elevated temperature, and a phase transformation in which parent and product phases have different densities.

Two adverse consequences of these stresses are distortion (or warpage) and fracture.

Full annealing: Heat to about 50°C above the A_3 line (if the concentration of carbon is less than the eutectoid) or above the A_1 line (if the concentration of carbon is greater than the eutectoid) until the alloy comes to equilibrium; then furnace cool to room temperature. The final microstructure is coarse pearlite.

Normalizing: Heat to at least 55°C above the A_3 line (if the concentration of carbon is less than the eutectoid) or above the A_{cm} line (if the concentration of carbon is greater than the eutectoid) until the alloy completely transforms to austenite, then cool in air. The final microstructure is fine pearlite.

Quenching: Heat to a temperature within the austenite phase region and allow the specimen to fully austenitize, then quench to room temperature in oil or water. The final microstructure is martensite.

Tempering: Heat a quenched (martensitic) specimen, to a temperature between 450 and 650°C, for the time necessary to achieve the desired hardness. The final microstructure is tempered martensite.

07(b).

- (i) **Why is unilateral tolerance preferred over bilateral tolerance? Find the limits of tolerance and allowance for a 25 mm H_8d_9 shaft and hole pair. The 25 mm shaft lies in the 18 - 30 diameter step. The fundamental tolerance can be computed using $i = 0.45\sqrt[3]{D} + 0.001D \mu\text{m}$. For H_8 hole, the fundamental tolerance is $25i$ and for d_9 shaft, the fundamental tolerance is $40i$. The fundamental deviation for the shaft can be computed using $-16D^{0.44} \mu\text{m}$. What type of fit is given by $H_8 d_9$?**

List the causes of getting primary texture and secondary texture in machined components. Further, list the three main methods of assessment of surface texture. (10 M)

Sol: Unilateral tolerance preferred over bilateral tolerance.

In Hole and Shaft assembly, unilateral tolerance are one sided to the basic size. i.e., either above or below the basic size or zero line as representing limits is convenient as per design criterion because both limits are either positive or negative.

In bilateral tolerance zone is across the basic size line bilateral tolerance is to make simplicity of representation for manufacturer as per I.S.O.

There are 25 types of tolerances for Hole and Shaft for Hole (A-G) above the zero line, "H" on the zero line, "J_s" across the zero line, (J-Z) below the zero line. For shaft (a-g) below the zero line, "h" on the zero line, "j_s" across the zero line, (j-z) above the zero line.



In this except J_s, j_s remaining all are unilateral tolerances i.e., (A-G), h, (J-Z) for Hole and (a-g), h, (j-z) for shaft 25H₈d₉ fundamental deviation for shaft (ϵ_D) = $-16D^{0.44}$

25 mm lies in the range (18 - 30)

$$\therefore D = \sqrt{D_1 D_2} = \sqrt{18 \times 30} = 23.24 \text{ mm}$$

Initial tolerance (or) fundamental tolerance

$$(i) = 0.45 \sqrt[3]{D} + 0.001D$$

$$\therefore i = 0.45 \sqrt[3]{23.24} + 0.001(23.24) = 1.3 \mu$$


$$IT8 = 25i = 25 \times 1.3 = 33 \mu = 0.033 \text{ mm}$$

$$IT9 = 40i = 40 \times 1.3 = 52 \mu = 0.052 \text{ mm}$$

$$\epsilon_D = -16D^{0.44} = -16(23.34)^{0.44} = 64 \mu = 0.064 \text{ mm}$$

$$\therefore \text{Hole } 25_{+0.0}^{+0.033} \text{ mm}$$

$$\text{Shaft } 25_{-0.116}^{-0.064} \text{ mm}$$

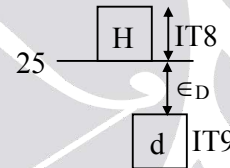

It is clearance fit with allowance = 0.064 mm

Primary and secondary texture in machined component. There are two types of irregularities on any machined surface. i.e., Roughness and waviness. Small wavelength fluctuations called primary texture (or) Roughness and large wave length fluctuations called secondary texture (or) waviness.

Roughness on machined surface mainly because of improper selection of cutting fluids, higher temperature on cutting zone and tool vibrations waviness or secondary texture is mainly due to machine and tool vibrations, work piece arrangements, guide way errors etc.



ACE[®]
Engineering Academy
Leading Institute for ESE/GATE/PSUs



Scan QR Code
for Website

LONG TERM PROGRAM

ESE+GATE+PSUs-2021

◆ Morning Batch

12th July 2019 @ Abids (EC/EE/ME/CE)

GATE+PSUs-2021

◆ Morning Batches

12th July 2019

@ Abids (EC/EE/ME/CE/CSIT/IN)
@ Kukatpally (EC/EE/ME/CE/CSIT/IN),
@ Dilsukhnagar (EC/EE/ME),
@ Kothapet (CE)

◆ Evening Batches

12th July 2019

@ Kukatpally (EC/EE/ME/CE/CSIT/IN)
@ Dilsukhnagar (EC/EE/ME)
@ Kothapet (CE)

Head Office Address: # 4-1-1236/1/A, Sindhu Sadan,
King Koti, Abids, Hyderabad – 500001, Telangana, India

website: www.aceenggacademy.com

ABIDS
040-23234418 / 19 / 20

KUKATPALLY
040-40199966, 93476 99966

DILSUKHNAGAR
040-40209345, 40044451

KOTHAPET
040-24034418 / 19



07(b).

- (ii) Five jobs are to be processed on three machines. The processing time (in hours) is given in the following table. Find the optimal schedule so that the total elapsed time is minimized. Also, find the idle time on each machine:

		Jobs				
		J ₁	J ₂	J ₃	J ₄	J ₅
Machines	M ₁	8	10	6	7	11
	M ₂	5	6	2	3	4
	M ₃	4	9	8	6	5

(10 M)

Sol:

Job	M ₁	M ₂	M ₃
J ₁	8	5	4
J ₂	10	6	9
J ₃	6	2	8
J ₄	7	3	6
J ₅	11	4	5

Check the following conditions:

1. $\text{Max}\{t_{2j}\} \leq \text{Min}\{t_{1j} \text{ or } t_{3j}\}$

If the condition is satisfied then create two virtual machines viz., M/c G and M/c H

Machine G processing time = $t_{1j} + t_{2j}$

Machine H processing time = $t_{2j} + t_{3j}$

Otherwise; the problem cannot be solved by means of Johnson's algorithm and one can conclude that the problem has no optimal solution (no guarantee for optimal values)

2. Get the optimum job sequence using algorithm, similar to n jobs & 2 machines
3. Calculate the make-span for the original data using the optimum job sequence.

Job	Machine G (M ₁ + M ₂)	Machine H (M ₂ + M ₃)
J ₁	13	9
J ₂	16	15
J ₃	8	10
J ₄	10	9
J ₅	15	9

According to Johnson's rule the sequence is as follows:

M/c G

M/c H

J ₃	J ₂	J ₅	J ₁	J ₄
----------------	----------------	----------------	----------------	----------------

Job	M ₁			M ₂			M ₃		
	In	PT	Out	In	PT	Out	In	PT	Out
J ₃	0	6	6	6	2	8	8	8	16
J ₂	6	10	16	16	6	22	22	9	31
J ₅	16	11	27	27	4	31	31	5	36
J ₁	27	8	35	35	5	40	40	4	44
J ₄	35	7	42	42	3	45	45	6	51

Total elapsed time = 51

Total time on M₁ = 51 – 42 = 9 hrs

Idle time on M₂ = (0 - 6) + (8 - 16) + (22 - 27) + (31 - 35) + (40 - 42) + (45 - 51)

$$= 6 + 8 + 5 + 4 + 2 + 6 = 31 \text{ hrs}$$

Idle time on M₃ = (0 - 8) + (16 - 22) + (31 - 31) + (36 - 40) + (44 - 45)

$$= 8 + 6 + 0 + 4 + 1 = 19 \text{ hrs}$$

07(c).


- (i) **What are natural and forced responses of a dynamic system? Derive the expression for dynamic natural response of a spring-mass system. (10 M)**

Sol: Natural response of dynamic system: It is the response (or) output of dynamic system naturally without applying input and observing the changes of system naturally.

Forced response: It is the response (or) output of dynamic system with applied forced input and observing the changes with forced input.

Expression for dynamic natural response of spring - mass system.

When mass is connected P end of spring, without damping, it oscillates freely without any input force, so its output is continuous oscillation.

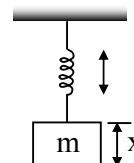


Free body diagram of mass:

As per D Alembert's Principle

$$mx'' + kx = 0$$

$$m \frac{d^2x}{dt^2} + kx = 0$$
 
$$\frac{d^2x}{dt^2} + \frac{k}{m}x = 0, \text{ so it oscillates with undamped natural frequency of } \omega_n = \sqrt{\frac{k}{m}}$$



- (ii) A vector $25\mathbf{i} + 10\mathbf{j} + 20\mathbf{k}$ is translated by 8 units in X and 5 units in Y directions. Subsequent to this the vector is rotated by 60° about Z-axis and 30° about X-axis. Determine the final form of the vector. (10 M)**

Sol: A vector $25\mathbf{i} + 10\mathbf{j} + 20\mathbf{k}$

→ It is translated 8 units → x and 5 units → y

→ Then the resultant vector is

$$33\mathbf{i} + 15\mathbf{j} + 20\mathbf{k}$$

→ Above vector rotated 60° , about z axis, then resultant vector is

$$\begin{bmatrix} c60^\circ & -s60^\circ & 0 \\ s60^\circ & c60^\circ & 0 \\ 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} 33 \\ 15 \\ 20 \end{bmatrix} = \begin{bmatrix} \frac{33-15\sqrt{3}}{2} \\ 33\sqrt{3}+15 \\ 20 \end{bmatrix}$$

$$c60^\circ = \frac{1}{2}, s60^\circ = \frac{\sqrt{3}}{2}$$

Now above vector is further rotated by 30° , around x axis $R(x, 30^\circ)$.

$$\text{Then resultant vector is } = \begin{bmatrix} 1 & 0 & 0 \\ 0 & \sqrt{3}/2 & -1/2 \\ 0 & 1/2 & \sqrt{3}/2 \end{bmatrix} \begin{bmatrix} \frac{33-15\sqrt{3}}{2} \\ 33\sqrt{3}+15 \\ 20 \end{bmatrix} = \begin{bmatrix} \frac{33-15\sqrt{3}}{2} \\ \frac{99+15\sqrt{3}}{4} - 10 \\ \frac{33\sqrt{3}+15}{4} + 10\sqrt{3} \end{bmatrix}$$

Then the final form of vector after above translation and rotations is

$$= \left(\frac{33-15\sqrt{3}}{2} \right) \mathbf{i} + \left(\frac{99+15\sqrt{3}}{4} - 10 \right) \mathbf{j} + \left(\frac{33\sqrt{3}+15}{4} + 10\sqrt{3} \right) \mathbf{k}$$



ACE
Engineering Academy
Leading Institute for ESE/GATE/PSUs



MPSC (MES) MAINS 2019

(Civil Engineering)

Regular Batch starts on **15th July 2019**

DISCOUNTS AVAILABLE

For ACE students of 2018-19 Session	50%
For ACE students of 2017-18 Session	30%
For ACE students of 2016 earlier	20%

MPSC (MES) MAINS FREE
Orientation & Demo
On 6th July 2019

IES GENERAL STUDIES BATCH

Type of Batch	Timings	Date	Duration	Venue
Weekend Batch	6 to 8 hours of classes Sat: 10am to 7pm & Sun 8am to 6pm	13 th July 2019	4 to 5 Months	@ Pune

83

Ranks in
Top 1000
from **Pune**

121

Ranks in
Top 2000
from **Pune**

153

Ranks in
Top 3000
from **Pune**

08(a). (i) Explain briefly the following:

- | | |
|---|--------------------------|
| (1) Four configurations of Robot | (2) Work volume |
| (3) Spatial resolution | (4) Accuracy |
| | (5) Repeatability |
- (10 M)**

Sol:

(1) Four types of robot configurations

- (a) Cartesian configuration
- (b) Cylindrical configuration
- (c) Spherical / polar configuration
- (d) Jointed arm configuration

(2) *Work volume* is space (or) volume of all points reached by robot tool movement with all joints movements.


Ex: Cartesian configuration work volume is rectangular / cuboid. As its tool can move to any point in rectangular / cuboid work volume.

(3) *Spatial resolution* combines the control resolution of all motions and also considered the mechanical errors arises from backlash in gears, Hysteresis, Deflection of links and hydraulic leaks.

(4) *Accuracy* is ability of robot to position the tool (or) end of wrist at target point (or) location in the specified work volume.

(5) *Repeatability* is measure ability of robot for position an object (or) tool repeatedly at previously taught points in the specified work volume.

(ii) A 4 d-o-f manipulator of Maker Robot type is shown in the figure given below. Prepare a D-H parameter table for this configuration. Define the position of end wrist P in terms of joint lengths and angles:

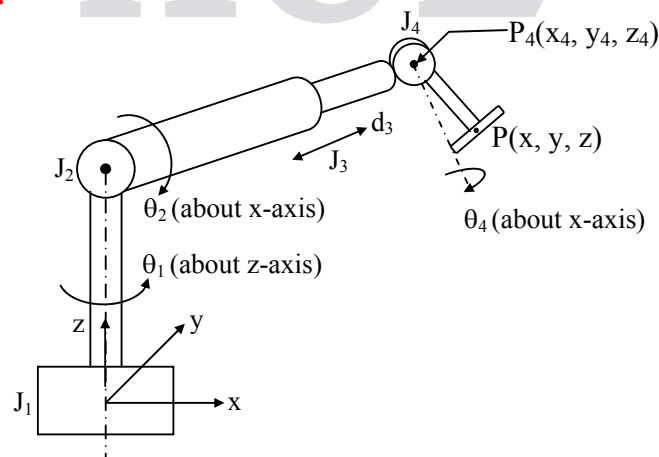

(10 M)

Sol: DOF manipulator,

D – 4 parameter table for given configuration is

	a	α	θ	d		$C\alpha$	$S\alpha$
1	0	0	θ_1	0	\rightarrow	1	0
2	0	$\pi/2$	θ_1	0	\rightarrow	0	1
3	0	$\pi/2$	0	d_3	\rightarrow	0	1
4	0	$\pi/2$	θ_4	0	\rightarrow	0	1

To know the position of end wrist P

$${}^0T^4 = {}^0T^1 \cdot {}^1T^2 \cdot {}^2T^3 \cdot {}^3T^4$$

$$= \begin{bmatrix} C_1 & -S_1 & 0 & 0 \\ S_1 & C_1 & 0 & 0 \\ 0 & 0 & 1 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} C_2 & 0 & S_2 & 0 \\ S_2 & 0 & -C_2 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} 1 & 0 & 0 & 0 \\ 0 & 0 & -1 & 0 \\ 0 & 1 & 0 & d_3 \\ 0 & 0 & 0 & 1 \end{bmatrix} \begin{bmatrix} C_4 & 0 & S_4 & 0 \\ S_4 & 0 & C_4 & 0 \\ 0 & 1 & 0 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

After multiplication of above four matrices

$$= \begin{bmatrix} {}^{124}C_1 & 0 & -S_{{}^{124}1} & S_{{}^{12}d_3} \\ {}^{124}S_1 & 0 & C_{{}^{124}1} & -C_{{}^{12}d_3} \\ 0 & -1 & 0 & 0 \\ 0 & 0 & 0 & 1 \end{bmatrix}$$

So position of end wrist P in terms of joint lengths and angles is

$$x = S_{{}^{12}d_3},$$

$$y = -C_{{}^{12}d_3},$$

$$z = 0$$

Note: $S_{12} = \sin(\theta_1 + \theta_2)$

$$C_{12} = \cos(\theta_1 + \theta_2)$$

$$C_{{}^{124}1} = \cos(\theta_1 + \theta_2 - \theta_4)$$


$$S_{{}^{124}1} = \sin(\theta_1 + \theta_2 - \theta_4)$$

08(b).

- (i) Draw the 'bathtub curve' and indicate various failure regions. List the major causes of failure in mechanical components/system. Draw the flowchart for failure modes and effects analysis (FMEA). (10 M)

Sol: Bathtub Curve:

The typical distribution of failure for a given product with time is important.

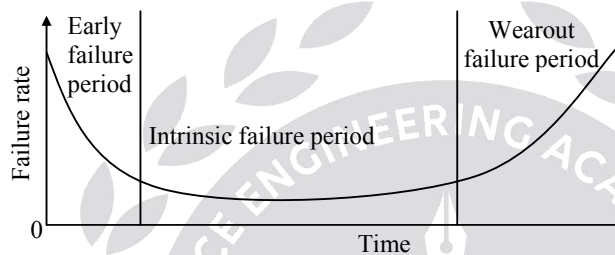

Early Failure or Infant Failure Period: Early life failures are often associated with fabrication issues, quality-control issues, or initial “shakedown” stresses, while age-related failure rates would increase with time.

Useful Life Period (Intrinsic Failure Period):


- As the product matures, the weaker units die off, the failure rate becomes nearly constant, and modules have entered into normal life period.
- It is characterized by a constant failure rate and the length of this period is referred to as the system life of a product or component. It is the period of time that the lowest failure rate occurs.
- The amplitude on the bathtub curve is at its lowest during this time. The useful life period is the most common time frame for making reliability predictions.

Wearout Failure Period: As components begin to fatigue or wearout, failures occur at increasing rates. Wearout in the rotating or sliding components are usually caused by the breakdown of system that is subject to physical wear, mechanical and thermal stress.

Major Causes of failures in mechanical components/systems: Most of the failures are caused by human errors, of which there are three general types:

- Errors of knowledge
- Errors of performance (which might be caused by negligence), or
- Errors of intent (which may come down to acts of greed)

FMEA Flow Chart :

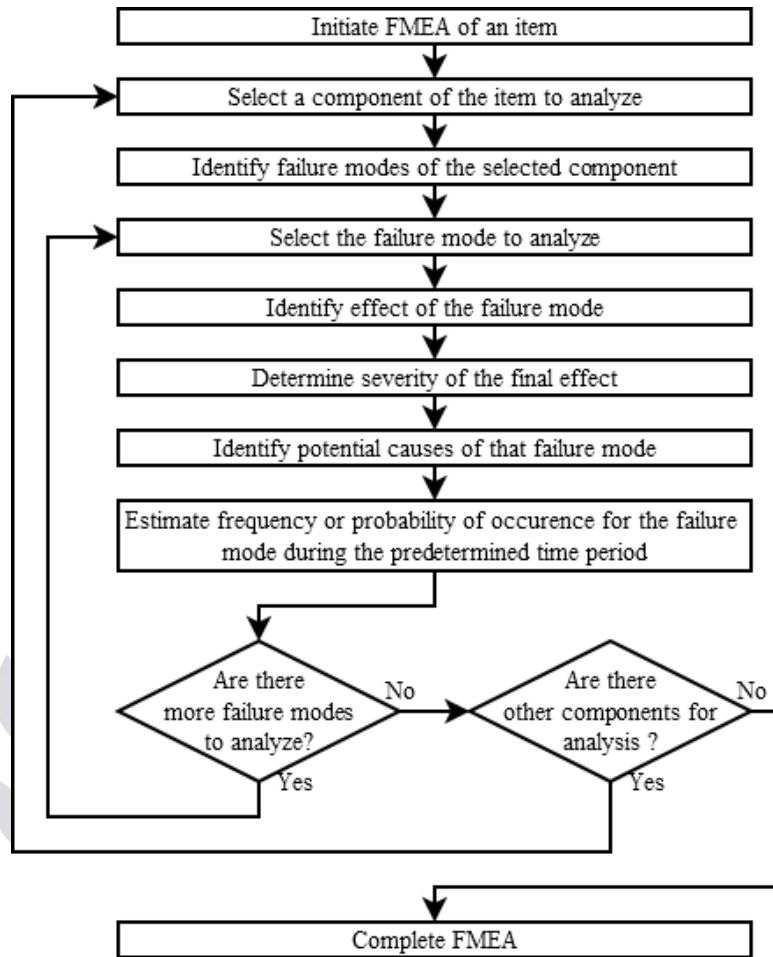



08(b).

(ii) Explain the mechanism of metal removal in die-sinking EDM. State the three main advantages of electron-beam machining (EBM). (10 M)

Sol: Die-Sinker EDM is known by different names such as Ram EDM, sinker EDM, vertical EDM and plunge EDM. The process is generally used for producing blind cavities. In die-sinker EDM, the electrode and workpiece are submerged in an insulating liquid such as oil or other dielectric fluids. The electrode and workpiece are connected to a suitable power supply. An electrical potential is generated between the tool and the workpiece through the power supply. As the electrode approaches workpiece, the dielectric break down starts taking place in the fluid. Due to this activity, a plasma channel starts forming and sparks jump from the electrode to the workpiece leading to material removal from the workpiece. The principle of die-sinking EDM is shown in Fig.1 and the schematic of die-sinker EDM process is shown in Fig.2

The main components of Die-sinker EDM are:

- Power supply.
- Dielectric system.
- Electrode
- Servo system.

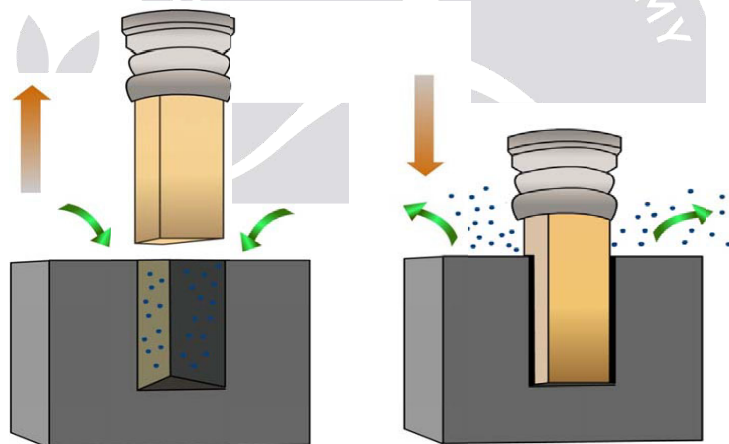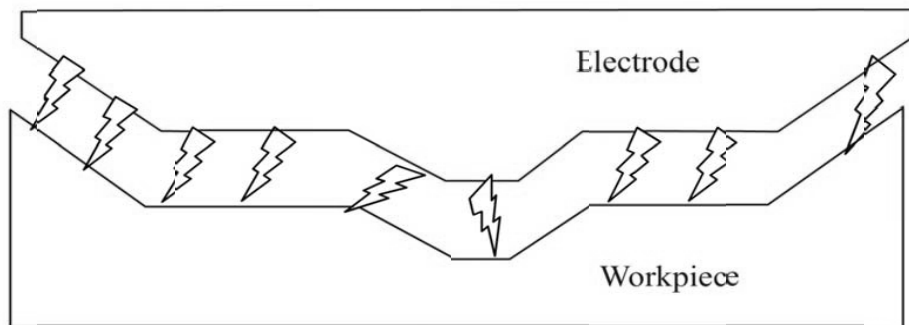

The main advantages of electron-beam machining (EBM)

- EBM provides very high drilling rates when small holes with large aspect ratio are to be drilled.
- It can machine almost any material irrespective of their mechanical properties.
- As it applies no mechanical cutting force, work holding and fixturing cost is very less. Further for the same reason fragile and brittle materials can also be processed.
- The heat affected zone in EBM is rather less due to shorter pulses.
- EBM can provide holes of any shape by combining beam deflection using electromagnetic coils and the CNC table with high accuracy.



ACE

Engineering Academy
Leading Institute for ESE/GATE/PSUs




Hearty Congratulations to our GATE-2019 TOPPERS



and many more...

GATE-2019 TOPPERS from Pune Classroom Program

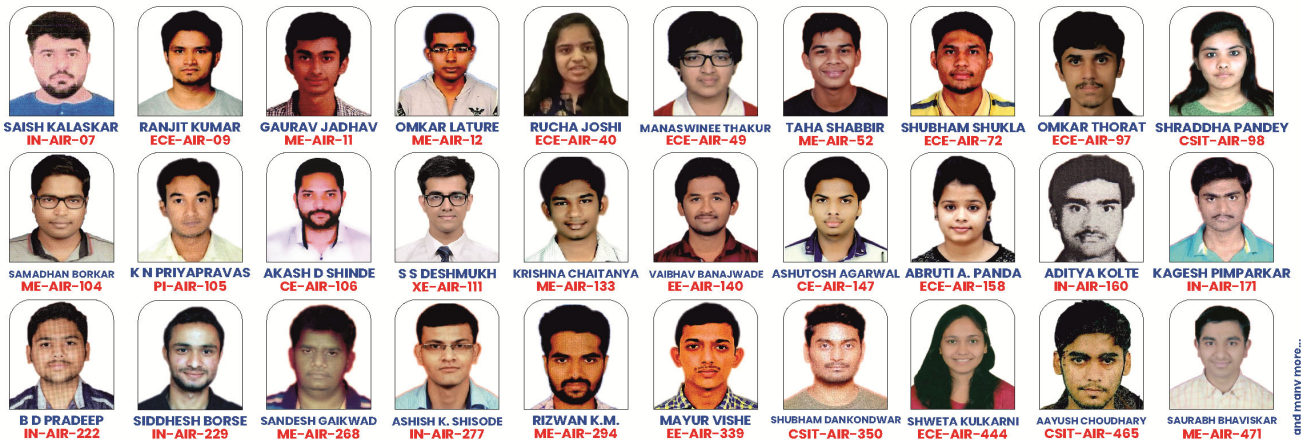

and many more...

MPSC (MES) 2018 Qualified Students from Pune



MPSC (MES)

INTERVIEWS

ESE+GATE +PSUs-2020

Streams: CE/ME/EC/EE

GATE+PSUs 2020

Streams: CE/ME/EC/EE

ESE+GATE +PSUs-2021

(Two Years Integrated program)

Streams: CE/ME/EC/EE/IN/CS/IT/PI

83

Ranks in Top 1000 from Pune

121

Ranks in Top 2000 from Pune

153

Ranks in Top 3000 from Pune

Regular Batches Commence

01st July 2019

Regular Batches Commence

**1st July 2019
15th July 2019**

Weekend Batches Commence

**6th July &
17th August
2019**

MPSC (MES) MAINS 2019

(Civil Engineering)

Regular Batch starts on **15th July 2019**

☎ 020-25535950, 09343499966

🌐 www.aceenggacademy.com

08(c). A manufacturer of patient medicines is proposed to prepare a production plan for medicines A and B. There are sufficient ingredients available to make 20000 bottles of medicine A and 40000 bottles of medicine B. However, there are only 45000 bottles into which either of the medicines can be filled. Further, it takes three hours to prepare enough material to fill 1000 bottles of medicine A and one hour to prepare enough material to fill 1000 bottles of medicine B, and there are 66 hours available for this operation. The profit is ₹ 8 per bottle for medicine A and ₹ 7 per bottle for medicine B.

- (i) Formulate this problem as linear programming problem.**
(ii) How does the manufacturer schedule his production in order to maximize profit?

Use graphical method.

(10 M)

Sol: Let x_1 = No. of bottles of medicine 'A'

x_2 = No. of bottles of medicine 'B'

Maximum, $z = 8x_1 + 7x_2$

Constraints:

Ingredients: $x_1 \leq 20000$

$x_2 \leq 40000$

$x_1 + x_2 \leq 45000$

Time: 1000A's \rightarrow 3 hrs

1A \rightarrow ?

Time for 1 bottle 'A' = $\frac{3}{1000}$

1000 B's \rightarrow 1 hr

1B \rightarrow ?

Time for 1 bottle 'B' = $\frac{1}{1000}$

$\frac{3}{1000}x_1 + \frac{1}{1000}x_2 \leq 66$

$\Rightarrow 3x_1 + x_2 \leq 66000$

LP model:

Maximum, $z = 8x_1 + 7x_2$

Subject to: $x_1 \leq 20000$

$x_2 \leq 40000$

$x_1 + x_2 \leq 45000$

$3x_1 + x_2 \leq 66000$

$x_1 \geq 0, \quad x_2 \geq 0$

$z_{\max} = 8x_1 + 7x_2$

$z|_{(0,0)} = 0$

$z|_{(0,40000)} = 8(0) + 7(40000) = 2,80,000$

$z|_{(5000,40000)} = 8(5000) + 7(40000) = 3,20,000$

$z|_{(10500,34500)} = 8(10500) + 7(34500) = 3,25,500$


$z|_{(20000,6000)} = 8(20000) + 7(6000) = 2,02,000$

$z|_{(20000,0)} = 8(20000) + 7(0) = 1,60,000$

No. of bottles of 'A' = 10500,

No. of bottles of 'B' = 34500

$z_{\max} = 3,25,500$

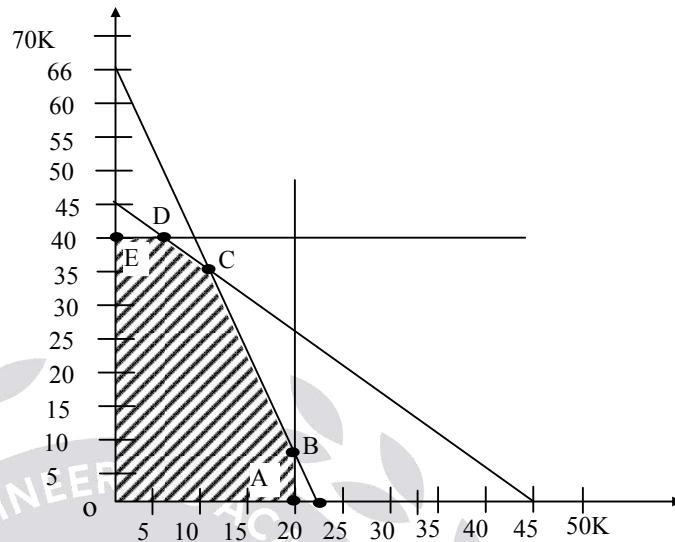

No. of bottles of 'A' = 10500,

No. of bottles of 'B' = 34500

$z_{\max} = 3,25,500$



ACE
Engineering Academy
Leading Institute for ESE/GATE/PSUs



Hearty Congratulations to our **GATE-2019 Toppers**

		AIR 1		CE	AIR 1		PI	AIR 1		EC	AIR 1		CSIT	AIR 1		IN																			
AIR 2		PI	AIR 2		EC	AIR 2		IN	AIR 2		EE	AIR 2		EE	AIR 3		CE	AIR 3		ME	AIR 3		EC	AIR 3		IN	AIR 3		CSIT	AIR 3		PI	AIR 4		ME
AIR 4		EC	AIR 4		EC	AIR 4		IN	AIR 4		IN	AIR 5		ME	AIR 5		XE	AIR 5		PI	AIR 5		EE	AIR 6		EE	AIR 6		PI	AIR 6		EC	AIR 6		IN
AIR 6		CSIT	AIR 7		CE	AIR 7		CE	AIR 7		PI	AIR 7		PI	AIR 7		EC	AIR 7		EC	AIR 7		IN	AIR 7		IN	AIR 7		EE	AIR 7		EE	AIR 9		PI
AIR 9		EC	AIR 9		IN	AIR 9		IN	AIR 9		CSIT	AIR 9		CSIT	AIR 10		CE	AIR 10		ME	AIR 10		PI	AIR 10		PI	AIR 10		XE	AIR 10		EE	and many more...		

Hearty Congratulations to our **ESE-2018 Toppers**

		AIR 1		E&T	AIR 1		EE	AIR 1		CE	AIR 1		ME										
AIR 2		E&T	AIR 2		EE	AIR 2		CE	AIR 2		ME	AIR 3		E&T	AIR 3		EE	AIR 3		CE			
AIR 3		ME	AIR 4		E&T	AIR 4		EE	AIR 4		ME	AIR 5		E&T	AIR 5		EE	AIR 5		CE	AIR 5		ME
ESE 2018 TOTAL SELECTIONS		347		E & T	TOTAL	89		E	TOTAL	78		C	TOTAL	88		M	TOTAL	89					

& MANY MORE...

48 AIR 1st in **GATE** **11** AIR 1st in **ESE**

Subscribe to our **Youtube Channel**

www.youtube.com/aceacademyhyd

for Latest Videos on
Preparation Strategy & Tips
for **ESE | GATE | PSUs**

By **CMD - ACE**
Prof. Y.V. Gopala Krishna Murthy

www.aceenggacademy.com

Contact: **040-23234418,19,20 - 24750437**